

Marion Township

Section 1
Date Established 7/15/2005
Corner NW
Marker RR Spike

42.60' E.S.E. to "+" in south end conc. headwall.
47.64' S.E. to duplex W/side of power pole
14.76' S.W. to "+" in NW corner of catch basin.
39.57' W. to SW corner. Sec. 36. Monroe Twp.

NW	

Section 1
Date Established 7/15/2005
Corner N¹/₄
Marker RR Spike

121.99' W.N.W. to duplex S/side of telephone pole
85.96' N.N.E. to SW corner of conc. foundation
31.73' N.E. to duplex S/side of telephone pole
57.33' S.E. to duplex N/side of power pole

	N ¹ / ₄

Section 1
Date Established 7/15/2005
Corner W¹/₄
Marker RR Spike.

15.32' N.W. to iron pin along west edge of pavement
36.91' E.S.E. to "+" top of east end NE bridge wing.
24.93' S.E. to NW corner of banister. east bridge rail
25.73' S.W. to NE corner of banister. west bridge rail

W ¹ / ₄	

Marion Township

Section 1

Date Established 8/2/2005

Corner E¹/₄

Marker Iron Pin


32.82' S.W. to "+" in north end of RCP (P)

66.28' S.S.W. to "+" south end of RCP (P)

89.72' S.S.E. to duplex E/side of power pole

84.80' S to W¹/₄ Post. Sec. 6, Bartlow Twp.

46.85' S to small RR Spike C/L Road F2

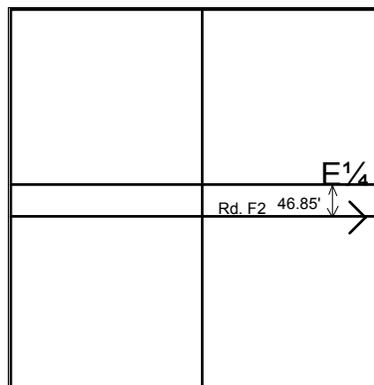

Marion Township

Section 2

Date Established 7/19/2005

Corner NW

Marker RR Spike

38.17' N.E. to shiner SW/side of power pole

26.64' W. to SW corner, Sec. 35, Monroe Twp.

58.53' N.W. to "+" in SE corner of headwall

67.72' S.W. to "+" in south end of conc. box.

Section 2

Date Established 7/19/2005

Corner N¹/₄

Marker RR Spike

39.64' S. to duplex W/side of power pole

45.12' S.W. to iron pin on south ditch bank

34.30' W. to S¹/₄ Post, Sec. 35, Monroe Twp.

19.75' N.W. to iron pin 1' north of north edge of pavement

NW	

	N ¹ / ₄

Marion Township

Section 3

Date Established 7/19/2005

Corner NW

Marker RR Spike

83.11' N.W. to "+" in NW corner of catch basin

33.32' S.E. to shiner W/side of telephone pole 4' tall

37.63' S.W. to PK nail SE/side of power pole

29.75' W. to SW corner. Sec. 34, Monroe Twp.

NW	

Section 3

Date Established 7/19/2005

Corner N¹/₄

Marker RR Spike

42.54' S.E. to PK in SW/side of power pole

30.88' S. to "+" on witness stone

27.56' W. to S¹/₄ Post. Sec. 34, Monroe Twp.

	N ¹ / ₄

Section 3

Date Established 7/19/2005

Corner W¹/₄

Marker RR Spike

27.30' N.W. to sawed "+" north end of CMP (P)

44.41' N.E. to PK W/side of power pole

28.37' S.W. to "+" in top of iron pipe (P) (no field check)

W ¹ / ₄	

Marion Township

Section 4
Date Established 7/19/2005
Corner NW
Marker RR Spike

- 70.32' W.N.W. to shiner SE/side of power pole
- 27.63' S.S.W. to "+" in top of conc. headwall
- 31.52' W. to SW corner, Sec. 33, Monroe Twp.
- 53.08' N.W. to "+" in north end of elliptical pipe
- 53.97' S.W. to "+" in south end of elliptical pipe.
- 38.21' S.E. to "+" in east end of 54" RCP

NW	

Section 4
Date Established 8/2/2005
Corner N¼
Marker Small RR Spike

- 30.58' W. to S¼ corner, Sec. 33, Monroe Twp.
- 34.61' N.W. to "+" in north end of elliptical RCP
- 37.18' S.W. to "+" in south end of elliptical RCP
- 58.83' N.W. to nail and shiner in SE/side of power pole

	N¼

Section 4
Date Established 7/19/2005
Corner W¼
Marker Iron pin.

- 27.05' E to PK nail in near face of corner post
- 50.57' S.E. to "+" in NE corner of catch basin

W¼	

Marion Township

Section 5
Date Established 7/19/2005
Corner NW
Marker RR Spike

36.02' N.W. to nail and shiner. S/side of power pole
82.24' S. to duplex W/side of power pole
65.72' W. to SW corner. Sec. 32. Monroe Twp.

NW	

Section 5
Date Established 7/19/2005
Corner N¹/₄
Marker RR Spike

53.65' W.N.W. to nail/shiner SE/side of power pole
48.29' W. to S¹/₄ post. Sec. 32. Monroe Twp.
20.28' N.E. to 5/8" iron pin along north edge of pavement

	N ¹ / ₄

Section 5
Date Established 7/19/2005
Corner W¹/₄
Marker Stone 10" below grade


2.47' S.E. to duplex SW/side of power pole
37.92' W.N.W. to duplex N/side of 16" hickory
52.00' N. to "+" in SW corner conc. pad for small windmill

W ¹ / ₄	

Marion Township


Section 6
Date Established 7/19/2005
Corner N¹/₄
Marker RR Spike

61.25' N.E. to nail and shiner in SW/side of power pole
26.15' S. to chisled "+" in NW corner conc. anchor post
77.98' W. to S¹/₄ post. Sec. 31, Monroe Twp.
23.46' S.E. to "+" in SW corner of catch basin

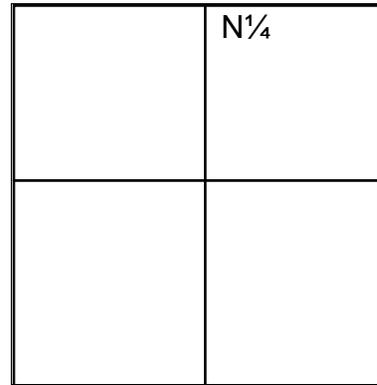


Section 6
Date Established 7/19/2005
Corner W¹/₄
Marker Iron Pin

45.68' WNW. near face gate post W/side field dr (no field check)
66.15' N. to E¹/₄ post. Sec. 1, Pleasant Twp. (not field checked)(P)
49.94' S.E. to "+" in NW corner of c. b. (not field checked)(P)
60.81' S.E. to duplex N/side of wood post (P)
52.07' S.W. to "+" in SE corner of c. b. (not field checked)(P)
60.80' S.W. to duplex E/side of power pole

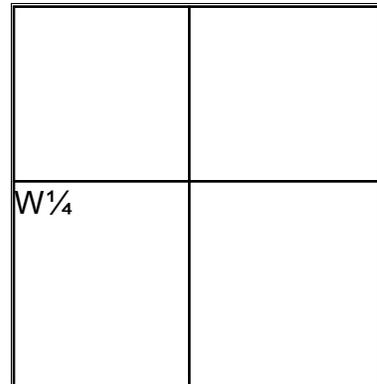

Section 6
Date Established 7/19/2005
Corner CENTER
Marker Iron Pin
2'± north of north edge of pavement

16.96' N. to "+" in conc. corner post
8.72' S. to RR spike
44.30' S. to PK nail in N/side of power pole

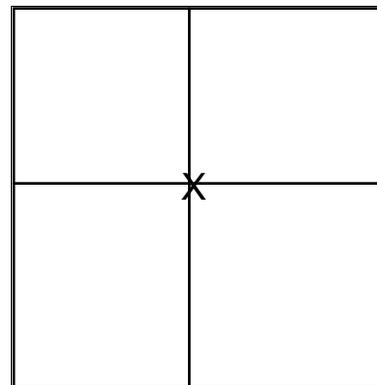

Marion Township

Section 6

Date Established 7/20/2005

Corner N¹/₄ SE

Marker ³/₄" Rebar
2.5' N. of north edge of pavement

151.00' W.S.W. to inside corner of south bridge rail

139.06' W. to inside corner of north bridge rail

27.41' S.E. to 5/8" iron pin along south edge of pavement

27.88' S.W. to 5/8" iron pin along south edge of pavement

	X N ¹ / ₄ SE

Marion Township

Section 7

Date Established 7/20/2005

Corner NW

Marker RR Spike

99.64' S.W. to PK nail E/side of power pole

35.77' N.E. to "+" in top of large rock (P)

53.55' N. to NE corner, Sec. 12, Pleasant Twp.

NW	

Section 7

Date Established 7/20/2005

Corner W¹/₄

Marker RR Spike

55.52' N.W. to PK nail east end of 18" CMP (P)

28.65' N.E. to 5/8" iron pin at east edge of pavement

47.55' N. to E¹/₄ post, Sec. 12, Pleasant Twp.

43.82' S.W. to 5/8" iron pin on west ditch bank (P)

W ¹ / ₄	

Section 7

Date Established 7/20/2005

Corner W¹/₄ SW

Marker RR Spike

58.61' N.W. to duplex NE/side of power pole

38.14' S.E. to duplex SW/side of power pole

29.89' N.E. to 5/8" iron pin along east edge of pavement

W ¹ / ₄ SW	

Marion Township

Section 8
Date Established 8/2/2005
Corner NW
Marker Iron Pin

85.22' E.S.E. to sawed "+" in conc. hdwl. for drive
12.64' W. to "+" in north end of 66" CIP
70.30' E.S.E. to duplex N/side of power pole (P)
27.59' S.W. to "+" in south end of 66' CIP (P)

NW	

Section 8
Date Established 7/20/2005
Corner N¹/₄
Marker RR Spike

26.29' S.E. to 5/8" iron pin on south ditch bank (P)
28.56' S.W. to 5/8" iron pin on south ditch bank (P)
18.44' N. to 5/8" iron pin along north edge of pavement
140.42' E.S.E. to duplex N/side of power pole (no field check)

	N ¹ / ₄

Section 8
Date Established 7/20/2005
Corner W¹/₄
Marker RR Spike

32.31' W. to duplex S/side of brace pole
20.20' E. to duplex W/side of power pole
70.94' S.S.E. to "+" in NE corner of catch basin (P)
68.66' S.S.W. to "+" in west end of conc. pipe (P)

W ¹ / ₄	

Marion Township

Section 9
Date Established 7/20/2005
Corner NW
Marker Iron Pin

- 38.27' N.W. to duplex NE/side of power pole
- 35.67' N.E. to PK nail SW/side of power pole
- 66.21' N.E. to "+" in NW wing
- 70.87' S.E. to "+" in SW wing
- 38.18' S.E. to PK nail in SW/side of power pole

NW	

Section 9
Date Established 7/20/2005
Corner N¹/₄
Marker RR Spike

- 26.31' N.N.W. to SW corner of catch basin
- 27.00' N. ot PK nail E/side of power pole
- 20.71' S.W. to 5/8" iron pin along south edge of pavement
- 32.44' to "+" in face of RR iron fence post.

	N ¹ / ₄

Section 9
Date Established 7/20/2005
Corner W¹/₄
Marker 3/4" Rebar

- 19.70' S.E. to "+" in headwall
- 31.12' S.W. to NE corner of catch basin
- 26.08' W. to "+" cut in face of steel fence post

W ¹ / ₄	

Marion Township

Section 10
Date Established 7/20/2005
Corner NW
Marker RR Spike

- 35.81' N.E. to duplex in SW/side of power pole
- 63.50' S.E. to duplex in W/side of telephone pole
- 42.06' N.W. to duplex in telephone pole (not field checked)
- 27.66' N.W. to PK nail in north end of CMP (P)
- 30.14' S.W. to PK nail in west end of 30" CMP (P)

NW	

Section 10
Date Established 7/20/2005
Corner N¼
Marker RR Spike

- 146.03' E.N.E. to duplex S/side of power pole
- 87.20' N.W. to PK nail in S/side of power pole
- 16.87' N. to 5/8" iron pin along north edge of pavement

	N¼

Section 10
Date Established 7/20/2005
Corner W¼
Marker Iron Pin
2' west of west edge of pavement


- 65.12' N.N.E. to PK in SW/side of power pole
- 32.99' N.W. to PK in north end of 36" corr. plastic tile
- 15.70' W.S.W. to PK in south end of 36" corr. plastic tile

W¼	

Marion Township


Section 11
Date Established 7/21/2005
Corner NW
Marker PK Nail

- 39.26' N.W. to "+" in north end of CMP (P)
- 45.20' N.W. to duplex SW/side of power pole
- 50.08' N.W. to nail/shiner in SE/side of power pole
- 71.69' S.W. to PK nail in E/side of power pole
- 41.14' S.W. to "+" in south end of CMP (P)

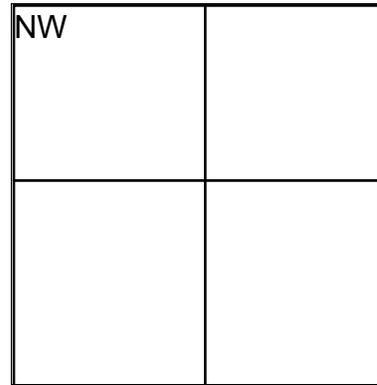


Section 11
Date Established 7/21/2005
Corner N¼
Marker RR Spike

- 25.23' N.E. to PK E/side of power pole
- 25.00' S.E. to "+" in S/end of headwall
- 51.95' S.W. to PK nail in W/end of 24" corr. plastic pipe
- 39.95' S. to PK nail in W/side of power pole

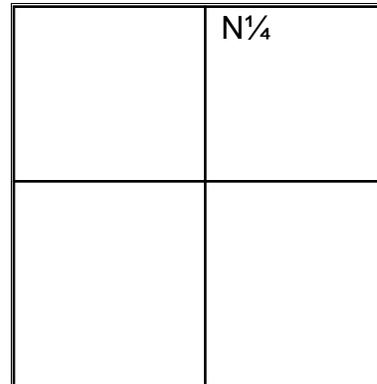

Section 11
Date Established 7/21/2005
Corner CENTER
Marker RR Spike

- 8.97' S.W. to 5/8" iron pin along west edge of pavement
- 9.68' N.W. to 5/8" iron pin along west edge of pavement
- 17.57' N.E. to "+" in jog of conc. drive (2½' east of SW corner)

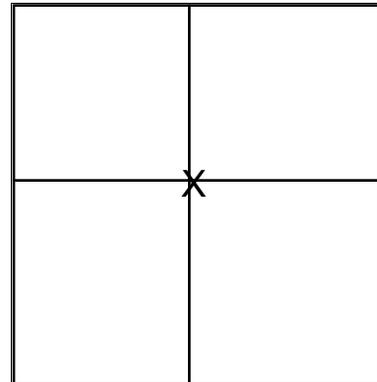

Marion Township

Section 12
Date Established 7/18/2005
Corner NW
Marker RR Spike

49.25' S.W. to PK in NE/side of telephone pole
100.83' N.N.W. to PK in SW/side of telephone pole
50.13' N.N.E. to sawed "+" in N/end of elliptical RCP
50.18' S.S.E. to sawed "+" in S/end of elliptical RCP

NW	

Section 12
Date Established 8/2/2005
Corner N¹/₄
Marker 5/8" Iron Pin

41.28' N.E. to duplex SE/side of power pole
27.98' N.W. to iron pin edge of berm 3' N of S edge of pavement

	N ¹ / ₄

Section 12
Date Established 7/18/2005
Corner NE
Marker RR Spike

48.25' W. to "+" in top center of conc. headwall (P)
66.04' N.N.E. to duplex NW/side of power pole
76.43' S. to NW corner. Sec. 7. Bartlow Twp.
27.92' E.N.E. to PK in W/side of guard rail post. S/end of rail

	NE

Marion Township

Section 12

Date Established 7/18/2005

Corner W¹/₄ NW

Marker Iron Pin

123.95' N.N.W. to PK in E/side of telephone pole

60.43' S.W. to duplex NW/side of telephone pole

35.00' S.S.E. to PK in E/end of 12" N12 pipe

40.05' S.W. to "+" in NE corner of catch basin

Section 12

Date Established 7/18/2005

Corner W¹/₄

Marker RR Spike

111.70' N.N.W. to PK in SW/side of telephone pole

84.25 S.S.E. to PK in NW/side of power pole

60.44' S.S.W. to PK in NE/side of telephone pole

39.07' S.E. to metal tee stake in conc. drainage structure

Section 12

Date Established 7/18/2005

Corner E¹/₄




Marker RR Spike

42.24' W.N.W. to "+" in north end of drainage structure

56.71' N.E. to duplex SE/side of power pole

58.68' S to W¹/₄ post. Sec. 7. Bartlow Twp.

39.49' W. to "+" in south end of drainage structure

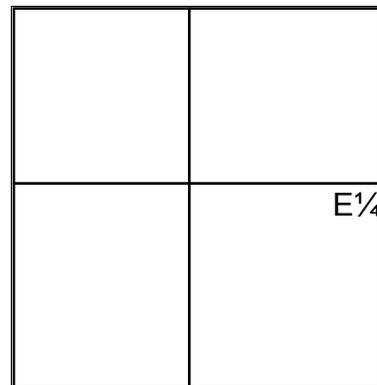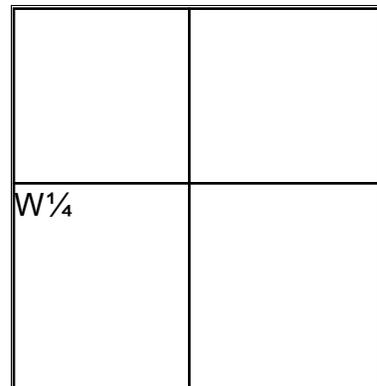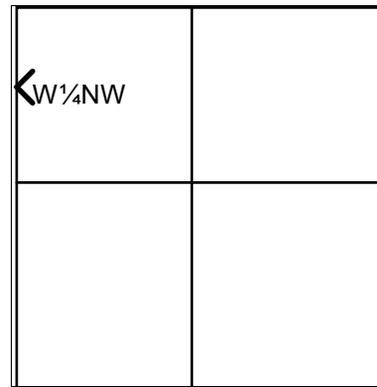

Marion Township

Section 13

Date Established 5/15/2012

Corner Wit. Stone to

Marker Mag Nail over Witness Stone

55.17' W.S.W. to mag nail in plastic tile (P)

45.54' N.W. to "+" N/side manhole rim

74.51' E.S.E. to mag nail in plastic tile (P)

40.05' S.E. to duplex N/side power pole

41.82' S.W. to duplex SE/side brace pole

9.90' E to Section Corner

Section 13

Date Established 5/15/2012

Corner NW

Marker RR Spike

64.67' W.S.W. to mag nail in plastic tile (P)

52.86' N.W. to "+" N/side manhole rim

64.76' E.S.E. to mag nail in plastic tile

35.47' S.E. to duplex N/side power pole

49.87' S.W. to duplex SE/side brace pole

9.90' W. to mag nail/witness stone

Section 13

Date Established 7/18/2005

Corner N¹/₄

Marker Iron Pin

30.70' S.S.E. to PK nail E/side of wood post

19.53' W.N.W. to "+" in E/end of 24" VCP (P)

NW	

NW	

	N ¹ / ₄

Marion Township

Section 13

Date Established 7/18/2005

Corner NE

Marker RR Spike

37.02' N.W. to duplex SE/side of telephone pole

44.25' S.E. to "+" NW cap bolt of fire hydrant

84.07' S. to NW corner, Sec. 18, Bartlow Twp.

33.58' S.W. to "+" in SW corner of catch basin

57.72' N.E. to "+" in S/side of man hole rim

66.06' S.W. to nail & shiner in NE/side of power pole

79.28' E.N.E. to "+" in N/side of man hole rim

Section 13

Date Established 7/18/2005

Corner E¹/₄

Marker Iron Pin

27.92' E.S.E. to nail/shiner W/side of power pole

	NE

	E ¹ / ₄

Marion Township

Section 14
Date Established 7/21/2005
Corner NW
Marker Small RR Spike

- 73.35' N.W. to conc. house foundation
- 33.45' N.E. to shiner in light pole
- 52.54' S.E. to nail/shiner in power pole
- 49.48' S.W. to shiner in telephone pole
- 11.21' S.S.W. to "+" in north rim of man hole
- 40.98' S.E. to "+" in SW corner of catch basin
- 36.88' S.E. to nail/shiner in NW/side of power pole
- 34.60' N.W. to "+" in S/end of conc. curb

Section 14
Date Established 7/21/2005
Corner N¹/₄
Marker RR Spike

- 55.60' N.W. to "+" in elliptical RCP
- 37.95' N.E. to "+" in south flange bolt of fire hydrant
- 49.79' S.W. to "+" in elliptical RCP
- 91.92' S.E. to PK in NW/side of power pole

Section 14
Date Established 7/21/2005
Corner W¹/₄
Marker PK Nail

- 104.80' N.N.E. to nail/shiner SW/side of power pole
- 84.62' S.S.E. to nail/shiner NW/side of power pole
- 99.12' N.N.W. to PK nail in SE/side of power pole

NW	

	N ¹ / ₄

W ¹ / ₄	

Marion Township

Section 14

Date Established 7/21/2005


Corner CENTER

Marker RR Spike

90.22' N.N.E. to duplex SW/side of power pole

18.66' W. to PK nail 15" from end of 8" CMP (P)

13.54' S.E. to 5/8" iron pin along east edge of pavement

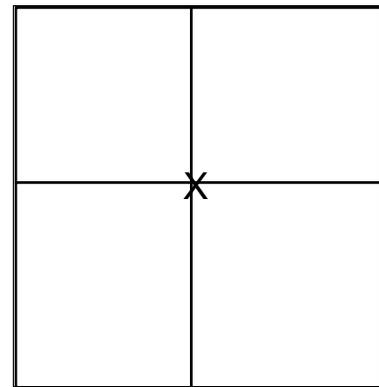

Marion Township

Section 15
Date Established 7/21/2005
Corner NW
Marker RR Spike

- 64.32' W.N.W. to PK nail NE/side of power pole
- 40.18' N.E. to PK nail NW/side of power pole
- 48.91' S.W. to "+" in west end of RCP
- 54.35' S.E. to "+" in east end of RCP

NW	

Section 15
Date Established 7/21/2005
Corner N¹/₄
Marker RR Spike

- 25.86' N. to corner of angle iron anchor post
- 32.20' N.E. to nail/shiner SW/side of power pole
- 18.31' S. to PK nail in east end of 36" corr. plastic tile

	N ¹ / ₄

Section 15
Date Established 7/21/2005
Corner W¹/₄
Marker RR Spike

- 66.56' S.S.E. to "+" in NW corner of building foundation
- 26.90' S.W. to duplex N/side of power pole
- 101.99' S.S.W. to PK nail in top of 18" corr. plastic tile

W ¹ / ₄	

Marion Township

Section 16

Date Established 7/21/2005

Corner NW

Marker RR Spike

34.62' N.E. to "+" N/end of west face of headwall

28.77' N.E. to "+" on face of headwall

18.19' S.E. to "+" in NW corner of conc. headwall

29.13' E.S.E. to "+" on top of conc. headwall (P)

59.28' S.W. to PK nail in N/side of power pole

Section 16

Date Established 7/21/2005

Corner N¹/₄

Marker RR Spike

20.41' N. to duplex W/side of corner post

10.38' S.W. to 5/8" iron pin along south edge of pavement

9.15' S.E. to 5/8" iron pin along south edge of pavement

NW	

	N ¹ / ₄

Marion Township

Section 17
Date Established 7/21/2005
Corner NW
Marker RR Spike

- 81.50' N.E. to PK nail W/side of power pole
- 33.45' N.W. to "+" north end of 66" conc. pipe (P)
- 27.36' S.W. to "+" south end of 66" conc. pipe (P)

NW	

Section 17
Date Established 7/21/2005
Corner N¹/₄
Marker RR Spike

- 37.26' N.E. to duplex SE/side of power pole
- 41.40' N.E. to "+" north end of 15" CIP (P)
- 58.85' E. to iron pin on centerline of Road 10A
- 92.51' E.S.E. to "+" east wall of catch basin (P)(no field check)
- 52.71' E.S.E. to "+" in conc. headwall (P)

	N ¹ / ₄

Section 17
Date Established 7/21/2005
Corner W¹/₄
Marker #6 Rebar

- 121.81' N.N.E. to duplex W/side of telephone pole
- 155.20' N.E. to SW corner of house foundation (no field check)
- 25.06' E. to duplex N/side of power pole
- 16.90' W. to "+" chiseled in top center rivet of pipe (P)
- 22.70' N.E. to "+" chiseled in top center rivet of pipe (P)

W ¹ / ₄	

Marion Township

Section 18
Date Established 7/21/2005
Corner NW
Marker RR Spike

- 31.96' S.E. to duplex W/side of power pole
- 14.85' N.W. to duplex E/side of north end post guard rail
- 13.45' S.W. to duplex E/side of south end post guard rail
- 53.99' E.S.E. to "+" in headwall (P)

NW	

Section 18
Date Established 7/21/2005
Corner N¹/₄
Marker RR Spike

- 31.29' N.W. to 5/8" iron pin at edge of pavement
- 28.60' N.E. to 5/8" iron pin at edge of pavement

	N ¹ / ₄

Section 18
Date Established 7/22/2005
Corner W¹/₄
Marker Rebar

- 50.30' N.W. to duplex NE/side of power pole (no field check)
- 23.25' E.S.E. to duplex S/side of power pole
- 80.41' N.N.E. to "+" SE corner of catch basin
- 41.03' N.W. to "+" in south end of 48" RCP
- 71.93' N.N.W. to "+" in north end of 48" RCP

W ¹ / ₄	

Marion Township

Section 19
Date Established 7/22/2005
Corner NW
Marker Iron Pin

- 50.18' S.E. to duplex W/side of telephone pole
- 38.73' S.W. to PK nail NE/side of power pole
- 41.03' N. to NW corner, Sec. 24, Pleasant Twp.
- 20.17' S.W. to "+" in south end of 42" RCP
- 91.56' N.N.W. to "+" in north end of 42" RCP

NW	

Section 19
Date Established 7/22/2005
Corner N¹/₄
Marker #4 Rebar

- 59.01' W.S.W. to "+" in east end of 30" RCP
- 64.55' S.S.W. to "+" E/side of conc. headwall (P)
- 19.20' N. to 5/8" iron pin along north edge of pavement

	N ¹ / ₄

Section 19
Date Established 7/22/2005
Corner W¹/₄
Marker Iron Pin

- 71.24' N.N.E. to "+" in SE corner of catch basin (P)
- 22.14' S.S.E. to PK north end of CMP (P)
- 42.56' W.N.W. to duplex S/side of power pole
- 39.33' N.W. to PK in south end of 36" corr. plastic tile

W ¹ / ₄	

Marion Township

Section 19

Date Established 7/22/2005


Corner N¹/₄ SW

Marker Iron Pin

18.38' N.W. to duplex SW/side of power pole

51.55' S.S.E. to "+" in NW corner of catch basin (P)

50.63' S.S.W. to "+" north end of conc. headwall (P)

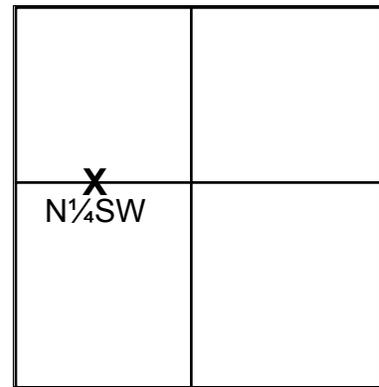

Marion Township

Section 20

Date Established 7/25/2005

Corner NW

Marker RR Spike

43.42' S.W. to PK nail SE/side of power pole

86.30' N.N.E. to near face of well casing

34.29' S.W. to "+" south end of RCP (P)

45.37' N.W. to "+" north end of RCP (P)

39.17' NE to PK nail NW/side of power pole

Section 20

Date Established 7/25/2005

Corner N¹/₄

Marker RR Spike

25.58' N.N.E. to duplex W/side of power pole

29.50' S.S.E. to "+" east end of RCP (P)

41.29' S.W. to "+" west end of RCP (P)

40.59' S.E. to PK nail SW/side of power pole

Section 20

Date Established 7/25/2005

Corner W¹/₄

Marker RR Spike

27.86' N.W. to duplex SW/side of power pole

51.61' S.W. to NE corner of conc. foundation

24.92' N.E. to PK in W/side of telephone pole

NW	

	N ¹ / ₄

W ¹ / ₄	

Marion Township

Section 20

Date Established 7/25/2005

Corner OTHER

Marker RR Spike


20.66' N.E. to duplex W/side of power pole

34.55' N.E. to "+" SW corner of catch basin (P)

46.27' S.E. to duplex SW/side of power pole

51.08' S.W. to duplex NW/side of power pole


23.48' S.W. to "+" in NE corner of catch basin

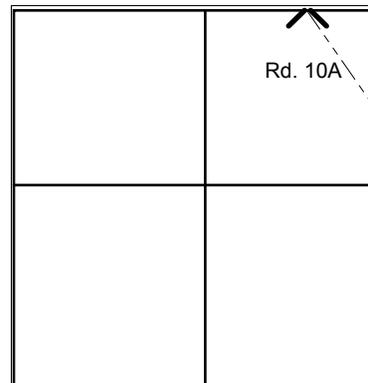

Marion Township


Section 21
Date Established 7/25/2005
Corner NW
Marker RR Spike

24.25' N. to duplex W/side of telephone pole
23.01' S.S.E. to duplex E/side of power pole
15.75' N.E. to iron pin along north edge of pavement
12.04' N.W. to iron pin along north edge of pavement

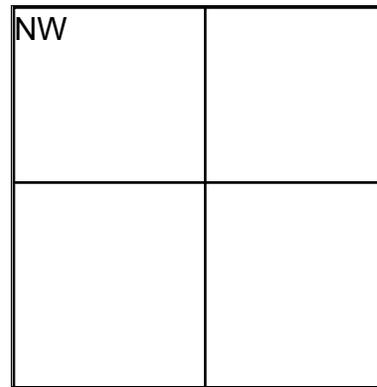


Section 21
Date Established 7/25/2005
Corner N¼
Marker RR Spike

41.13' N.W. to PK nail SE/side of power pole
19.46' S.E. to iron pin along south edge of pavement
80.51' S.W. to duplex N/side of power pole

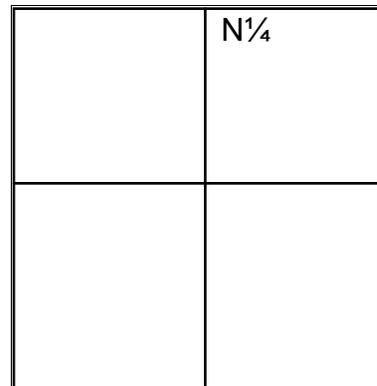

Section 21
Date Established 7/25/2005
Corner N¼ NE
Marker Iron Pin

20.02' N.W. to "+" in SW corner of catch basin
37.04' S.W. to PK in W/side of power pole
43.92' S.E. to iron pin along south edge of pavement

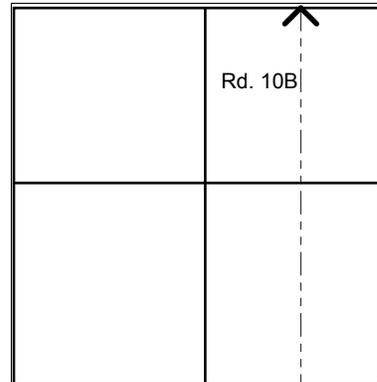

Marion Township

Section 21

Date Established 7/25/2005

Corner N¼ SE

Marker RR Spike

21.88' W. to duplex N/side of power pole

36.70' N.W. to ¾" iron pin

19.82' E. to ¾" iron pin

17.83' S.E. to "+" S/side of round catch basin

27.85' S.W. to PK nail south end of 12" CMP

17.04' S.W. to PK nail north end of 12" CMP

Section 21

Date Established 4/2/2014

Corner OTHER

Marker Mag. Nail 0.75 mi. south of Road D



45.16' S.W. to duplex on E/side of power pole

17.91' W.S.W. to mag nail in south end 12" CMP

21.60' N.W. to PK nail on north end 12" CMP

9.38' S.E. to iron pin at edge of pavement

10.92' N.E. to iron pin at edge of pavement

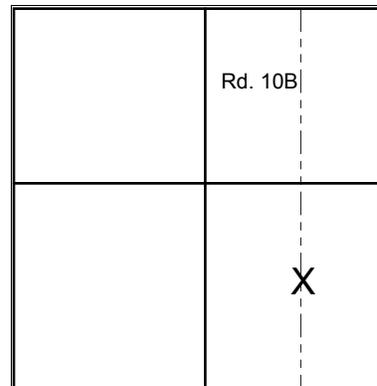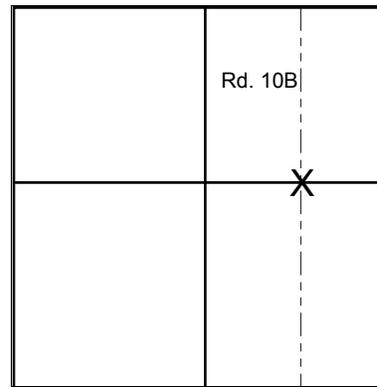

Marion Township

Section 22

Date Established 7/25/2005

Corner NW

Marker RR Spike

25.50' S. to angle iron

32.87' S.W. to duplex on power pole

57.67' N.E. to PK SE/side of power pole

74.46' N.W. to "+" in SE corner of school foundation

Section 22

Date Established 7/25/2005

Corner N¹/₄

Marker RR Spike

24.70' S.W. to duplex in power pole

18.70' N.W. to iron pin along north edge of pavement

20.61' N.E. to iron pin along north edge of pavement

NW	

	N ¹ / ₄

Marion Township

Section 23
Date Established 7/25/2005
Corner NW
Marker PK Nail

- 41.64' S.E. to PK east end of 12" CMP (P)
- 35.15' S.W. to PK west end of 12" CMP (P)
- 35.10' S.W. to duplex SE/side of power pole
- 57.35' N.W. to PK SW/side of power pole

NW	

Section 23
Date Established 7/25/2005
Corner N¹/₄
Marker RR Spike

- 57.96' N.W. to "+" in north end of RCP (P)
- 40.51' N.E. to duplex SE/side of power pole
- 21.82' S.E. to duplex NW/side of power pole
- 45.00' S.W. to "+" in south end of RCP (P)

	N ¹ / ₄

Section 23
Date Established 7/25/2005
Corner W¹/₄
Marker PK & Shiner

- 22.72' W.S.W. to PK nail east end of 12" CMP (P)
- 24.21' S.E. to iron pin along east edge of pavement
- 27.61' N.E. to iron pin along east edge of pavement

W ¹ / ₄	

Marion Township

Section 23

Date Established 7/25/2005


Corner CENTER

Marker RR Spike

53.08' N.N.W. to PK nail west end of 8" corr. plastic pipe

25.47' S.E. to duplex W/side of power pole

16.69' S.S.W. to 5/8" iron pin at west edge of pavement

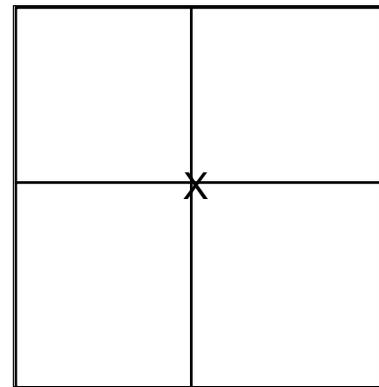

Marion Township

Section 24
Date Established 7/18/2005
Corner NW
Marker RR Spike

- 27.27' N.W. to "+" west end of conc. headwall (P)
- 20.06' N.N.W. to "+" east end conc. headwall (P)
- 24.53' S.S.W. to "+" in conc. headwall (P)
- 23.95' W.S.W. to "+" in conc. headwall (P)

NW	

Section 24
Date Established 7/18/2005
Corner N¼
Marker RR Spike

- 56.81' S.W. to duplex N/side of power pole
- 68.89' W.S.W. to "+" inside corner of south bridge rail
- 61.44' W.N.W. to inside corner north bridge rail
- 24.48' S.S.E. to PK in east end of 15" corr. plastic pipe

	N¼

Section 24
Date Established 7/18/2005
Corner NE
Marker RR Spike.

- 8.05' S.W. to duplex SE/side of guard rail post
- 10.76' N.W. to duplex E/side of guard rail post
- 79.53' S. to NW corner. Sec. 19. Bartlow Twp.

	NE

Marion Township

Section 24

Date Established 7/18/2005

Corner W¹/₄

Marker Iron Pin

25.79' N.W. to 5/8" iron pin on west ditch bank (P)

22.91' S.W. to 5/8" iron pin on west ditch bank (P)

18.66' E. to 5/8" iron pin 1' east of east edge of pavement

W ¹ / ₄	

Section 24

Date Established 7/26/2005

Corner E¹/₄

Marker RR Spike

16.36' S.W. to duplex on power pole

117.72' S.E. to "+" in NW corner of conc. catch basin

68.58' S. to W¹/₄ corner. Sec. 19. Bartlow Twp.

21.17' S.E. to iron pin along east edge of pavement

	E ¹ / ₄

Section 24

Date Established 7/26/2005

Corner E¹/₄ SE

Marker RR Spike

8.04' W. to duplex N/side of power pole

49.50' N.E. to duplex SE/side of buried cable marker

72.89' S. to RR spike in pavement

92.31' S.S.E. to "+" in east side of catch basin

	E ¹ / ₄ SE >

Marion Township

Section 25
Date Established 7/18/2005
Corner NW
Marker RR Spike

- 27.56' N.W. to "+" north end of 72" RCP (P)
- 38.87' N.E. to duplex SE/side of underground cable marker
- 36.63' S.E. to duplex NE/side of underground cable marker
- 92.76' S.S.E. to duplex W/side of power pole
- 30.68' S.W. to "+" south end of 72" RCP (P)

NW	

Section 25
Date Established 8/1/2005
Corner N¼
Marker Iron Pin

- 66.16' E.S.E. to PK nail in CMP
- 4.71' N. to 5/8" iron pin on ditch bank

	N¼

Section 25
Date Established 7/26/2005
Corner NE
Marker RR Spike

- 19.80' W.N.W. to "+" south end of 10' CMP arch (P)
- 66.16' N.N.W. to duplex E/side of power pole
- 55.25' S.S.W. to duplex E/side of north guard rail post
- 55.82' N.N.W. to "+" in north end of 10' CMP arch (P)
- 15.73' E. to 5/8" iron pin along east edge of pavement

	NE

Marion Township

Section 25

Date Established 7/26/2005

Corner W¹/₄

Marker RR Spike

34.93' W. to 30d spike N/side of wood anchor post

26.22' N.E. to duplex NW/side of power pole

55.09' S.S.W. to PK nail in west end 8" CMP (P)

30.54' S.E. to iron pin along east edge of pavement

Section 25

Date Established 7/26/2005

Corner E¹/₄

Marker RR Spike

147.41' N. to duplex E/side of power pole

119.11' S.S.E. to "+" NW corner conc. catch basin (P)

68.63' S. to E¹/₄ Post, Sec. 30, Bartlow Twp.

87.13' S.S.W. to duplex E/side of power pole

31.69' S.W. to 5/8" iron pin on ditch bank (P)

36.65' N.W. to 5/8" iron pin on ditch bank (P)

W ¹ / ₄	

	E ¹ / ₄

Marion Township

Section 26
Date Established 7/25/2005
Corner NW
Marker PK Nail

- 17.93' W.S.W. to "+" west end of stone headwall (P)
- 30.86' S.E. to iron pin along east edge of pavement
- 27.72' S.W. to nail and shiner NE/side of power pole
- 102.75' S.W. to NE corner church foundation

NW	

Section 26
Date Established 7/25/2005
Corner N¹/₄
Marker RR Spike

- 84.30' N.N.E. to PK nail SE/side of power pole
- 55.93' E.N.E. to PK nail W/side of power pole
- 10.35' S.W. to iron pin along south edge of pavement

	N ¹ / ₄

Section 26
Date Established 7/25/2005
Corner W¹/₄
Marker PK & Shiner

- 71.02' N.E. to nail/shiner SW/side of underground cable marker
- 36.56' S.W. to nail/shiner NE/side of power pole
- 42.68' S.E. to "+" in south end of 12" CMP
- 24.48' E.S.E. to "+" in north end of 12" CMP

W ¹ / ₄	

Marion Township

Section 27

Date Established 7/26/2005

Corner NW

Marker RR Spike

29.97' N.W. to duplex E/side of power pole

11.94' N.N.E. to "+" east end abandoned wing(P)(no field check)

64.94' S.S.E. to duplex W/side of power pole

99.40' S.W. to NE corner block foundation of house

15.00' N.E. to PK nail in SE/side of guard rail post

Section 27

Date Established 7/26/2005

Corner N¹/₄ NW

Marker RR Spike

127.07' W.N.W. to PK S/side of power pole

23.02' S.S.W. to PK W/side of wood corner post

16.98' N.E. to iron pin along north edge of pavement

Section 27

Date Established 7/26/2005

Corner N¹/₄

Marker Iron Pin

111.05' S.S.E. to PK nail in N/side of light pole

32.98' N.E. to PK in NW corner of metal building foundation

44.71' S.E. to PK in SW corner of metal building foundation

NW	

N ¹ / ₄ NW	

	N ¹ / ₄

Marion Township

Section 27

Date Established 7/26/2005

Corner W¹/₄ NW

Marker Iron Pin

22.10' W to sawed "+" in near face of conc. anchor post

72.21' N.E. to duplex SE/side of power pole

39.83' S.E. to iron pin on east top of bank

Section 27

Date Established 7/26/2005



Corner W¹/₄

Marker Iron Pin

57.97' N.E. to duplex W/side of power pole (P)

32.98' S.W. to "+" north end CMP (P)

25.40' S.E. to iron pin along east edge of pavement

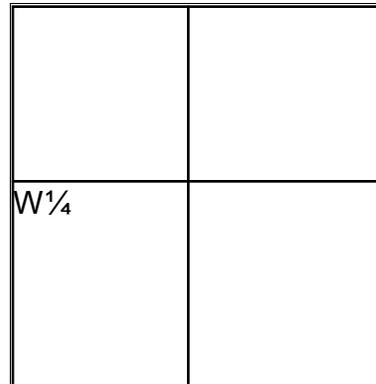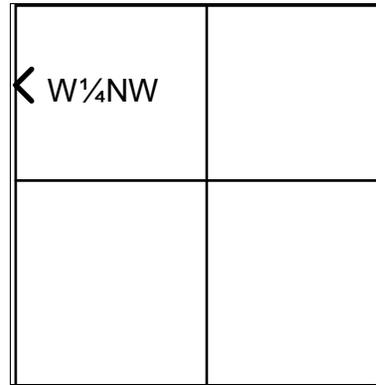

Marion Township

Section 28

Date Established 7/26/2005

Corner N¹/₄

Marker RR Spike

5.92' W.S.W. to NE corner Urban E. Edwards tombstone

19.16' N.W. to SE corner Josiah L. Kieth tombstone

24.45' N.W. to SE corner Dr. C.M. Overhulse tombstone

22.10' N. to SE corner Joseph D. Kinney tombstone

Section 28

Date Established 7/26/2005

Corner N¹/₄ NE

Marker Small RR Spike

34.08' N.W. to duplex SE/side of power pole

76.20' S.E. to PK SW/side of telephone pole

26.55' N.E. to iron pin along edge of pavement radius

23.72' S.W. to iron pin along south edge of pavement

	N ¹ / ₄

	N ¹ / ₄ NE

Marion Township

Section 29
Date Established 7/27/2005
Corner NW
Marker RR Spike

- 21.30' N.N.W. to "+" in conc. curb
- 54.83' N.N.W. to "+" in SE corner conc. drive
- 106.60' N.N.E. to duplex E/side of telephone pole
- 82.82' S.S.W. to PK in E/side of power pole

NW	

Section 29
Date Established 7/27/2005
Corner N¼
Marker Iron Pin

- 39.72' N.E. to 5/8" iron pin on east ditch bank (P)
- 34.26' S.E. to 5/8" iron pin on east ditch bank (P)
- 12.47' W. to an iron pin on west top of bank

	N¼

Section 29
Date Established 7/27/2005
Corner W¼ NE
Marker Iron Pin

- 39.30' N.E. to 5/8" iron pin on east ditch bank (P)
- 24.47' E. to duplex N/side of power pole
- 34.17' S.E. to 5/8" iron pin on east ditch bank (P)

	X W¼NE

Marion Township

Section 29

Date Established 7/27/2005

Corner W¹/₄

Marker RR Spike

19.90' W.N.W. to duplex NE/side of power pole

14.44' E. to PK in S/side of telephone pole

20.54' S.W. to iron pin along west edge of pavement

W ¹ / ₄	

Marion Township

Section 30

Date Established 7/27/2005

Corner NW


Marker RR Spike

120.54' W. to "+" in south end conc. headwall (P)

26.25' N.N.E. to PK east end of 18" CMP (P)

17.15' N.W. to iron pin along north edge of pavement

19.24' N.E. to iron pin along north edge of pavement

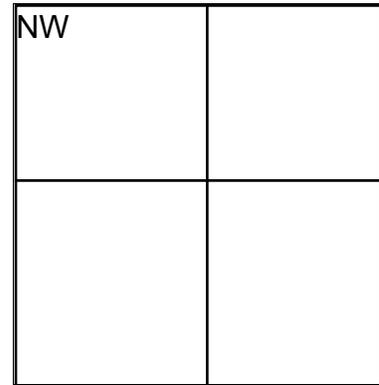

Section 30

Date Established 7/27/2005


Corner N¹/₄ NW

Marker RR Spike

24.70' N.W. to "+" in center of conc. headwall (P)

24.69' S.E. to "+" NE corner of catch basin (P)

17.78' S.W. to iron pin along mid radius

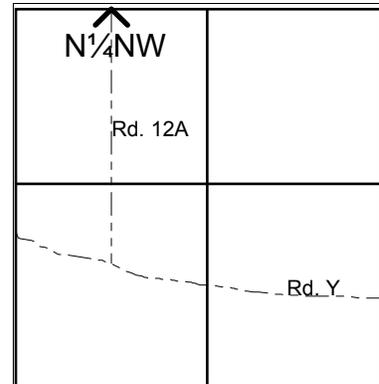

Section 30

Date Established 7/27/2005


Corner OTHER

Marker RR Spike

23.48' W.N.W. to duplex N/side of telephone pole

27.75' N.N.E. to 5/8" iron pin 1' east of edge of pavement

25.71' S.S.E. to 5/8" iron pin 1' east of edge of pavement

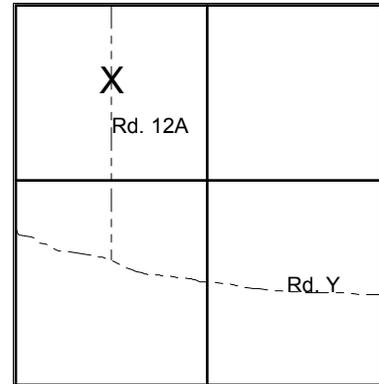

Marion Township

Section 31
Date Established 7/27/2005
Corner NW
Marker Iron Pin

- 20.56' N.W. to "+" south end of 84" RCP (P)
- 43.58' N.W. to duplex NE/side of telephone pole (P)
- 71.01' N.N.W. to "+" north end of 84" RCP (P)
- 37.15' N. to NE corner. Sec. 36. Pleasant Twp.
- 79.82' N.W. to duplex SW/side of power pole
- 21.54' E.N.E. to duplex W/side of telephone pole

NW	

Section 31
Date Established 7/27/2005
Corner W¹/₄
Marker Iron Pin

- 18.22' N. to E¹/₄ Post. Sec. 36. Pleasant Twp.
- 65.92' N.N.W. to "+" in north end of 56" RCP
- 23.68' S.W. to "+" in south end of 56" RCP
- 25.51' E. to duplex S/side of wood post

W ¹ / ₄	

Section 31
Date Established 7/27/2005
Corner SW
Marker RR Spike

- 42.74' N.W. to duplex SW/side of power pole
- 47.26' N.E. to PK nail S/side of telephone pole
- 39.82' S.W. to duplex NW/side of telephone pole
- 44.61' S.W. to "+" in west end of CMP

SW	

Marion Township

Section 31

Date Established 7/27/2005

Corner S¹/₄ SW

Marker RR Spike

44.76' S.E. to near face of CIP anchor post

8.70' N.E. to iron pin along north edge of pavement

13.27' N.N.W. to duplex in E/side of power pole

Section 31

Date Established 7/27/2005



Corner S¹/₄

Marker RR Spike

48.00' S.E. to sawed "+" in NW corner conc. anchor post

17.99' E.N.E. to iron pin along north edge of pavement

23.72' S.W. to iron pin along south edge of pavement

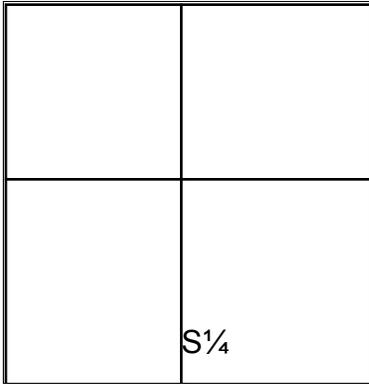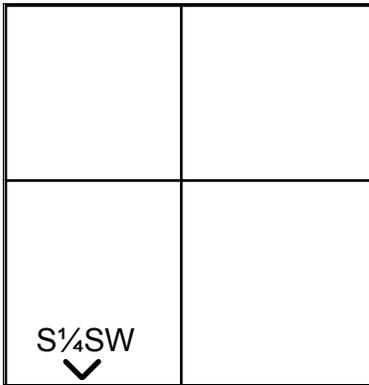

Marion Township

Section 32

Date Established 7/27/2005

Corner NW

Marker RR Spike

32.06' S.E. to "+" in NW corner catch basin (P)

28.98' N. to duplex SE/side of power pole

18.41' S.W. to PK nail in 10" CMP

NW	

Section 32

Date Established 7/27/2005

Corner N¹/₄

Marker RR Spike

15.25' E.S.E. to 5/8" iron pin at south edge of pavement

18.14' W.S.W. to 5/8" iron pin along south edge of pavement

11.07' N. to 5/8" iron pin along north edge of pavement

	N ¹ / ₄

Section 32

Date Established 7/27/2005

Corner W¹/₄

Marker Iron Pin

13¹/₂' west of west edge of pavement

No Ties

W ¹ / ₄	

Marion Township

Section 32
Date Established 7/27/2005
Corner SW
Marker 5/8" Rebar

- 47.21' N.W. to duplex SW/side of power pole
- 43.76' N.W. to "+" west end conc. headwall (no field check)
- 36.40' N.N.W. to "+" east end conc. headwall (no field check)
- 4.32' S.S.W. to duplex in NW/side first brace of guard rail
- 33.39' W.S.W. to duplex N/side last guard rail post
- 57.27' N.E. to duplex SE/side of telephone pole

SW	

Section 32
Date Established 7/27/2005
Corner S¹/₄
Marker Iron Pin


- 26.55' S.E. to "+" in east end of RCP (P)
- 21.25' S.W. to "+" in west end of RCP (P)
- 22.73' N. to top of leaning iron pin

	S ¹ / ₄

Marion Township


Section 33
Date Established 7/27/2005
Corner NW
Marker RR Spike

19.45' N.N.W. to duplex E/side of telephone pole
22.51' N.E. to 5/8" iron pin N/side of pavement
21.89' S. to near edge angle iron post (no field check)
11.36' S.E. to 5/8" iron pin along south edge of pavement

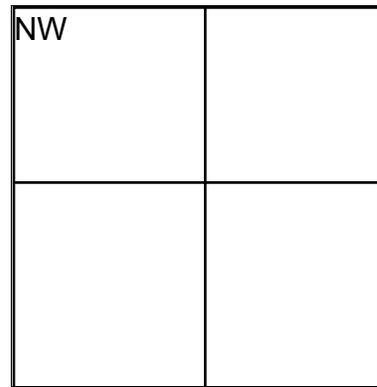


Section 33
Date Established 9/23/2014
Corner OTHER
Marker RR Spike

Intersection of 10A & B
No Ties to Stone

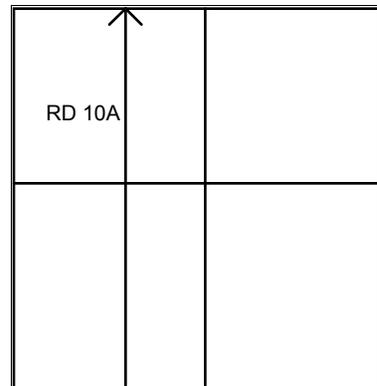

Section 33
Date Established 7/28/2005
Corner N¼
Marker RR Spike

20.49' N. to "+" W/side of conc. anchor post
28.01' N.E. to "+" east end conc. headwall
95.00' E.N.E. to duplex S/side of telephone pole
13.38' S.E. to "+" in headwall
23.02' S.S.E. to "+" in conc. headwall

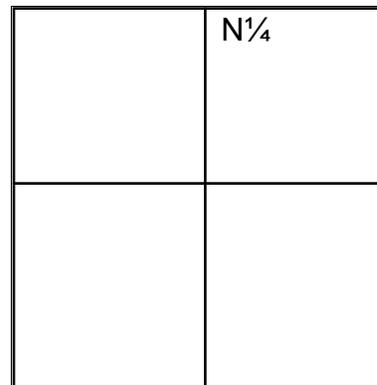

Marion Township

Section 33

Date Established 11/16/2016

Corner W¹/₄

Marker Found stone (12 x 10 x 6) with Iron Pin on SE side of stone

Iron Pin is for locating purposes only. Placed sign post and sign indicating surveying marker. Center of stone is 0.7' west of sign post. Refer to County GPS co-ordinates for location of stone.

W ¹ / ₄	

Section 33

Date Established 7/28/2005

Corner SW

Marker Small RR Spike over Iron Pin

33.03' S. to duplex E/side of wood corner post
20.30' S.W. to 5/8" iron pin on north bank of roadside ditch
20.10' S.E. to 5/8" iron pin on north bank of roadside ditch

SW	

Section 33

Date Established 7/28/2005

Corner S¹/₄

Marker 5/8" Iron Pin

15.70' E. to Putnam Co. stone (no field check)
47.05' E.S.E. to 5/8" iron pin on north ditch bank
31.86' S.E. to duplex N/side of wood anchor post
16.66' S.W. to iron pin on north ditch bank

	S ¹ / ₄

Marion Township

Section 34
Date Established 7/28/2005
Corner NW
Marker RR Spike

- 31.18' N.W. to "+" north end of RCP (P)
- 39.59' N.E. to duplex SE/side of power pole
- 31.07' S.E. to "+" in center of conc. headwall
- 20.25' S.W. to "+" in center of conc. headwall (P)

NW	

Section 34
Date Established 7/28/2005
Corner N¹/₄
Marker RR Spike

- 52.68' E.N.E. to nail/shiner S/side of power pole
- 109.39' W.S.W. to duplex N/side of power pole
- 27.51' N.W. to iron pin along north edge of pavement

	N ¹ / ₄

Section 34
Date Established 7/28/2005
Corner W¹/₄
Marker Iron Pin

- 79.00' N.W. to SE corner block house foundation
- 44.79' N.E. to duplex SE/side power pole
- 22.57' S.W. to PK nail in 24" CMP (P)
- 49.37' N.N.W. to "+" in north end of 48" CIP
- 33.23' S.E. to duplex in NE/side of power pole

W ¹ / ₄	

Marion Township

Section 34

Date Established 7/28/2005

Corner W¹/₄ SW

Marker Iron Pin

21.77' E. to duplex N/side of wood post (post is loose)

31.80' S.E. to duplex NE/side of power pole

39.03' S.W. to PK nail in 18" CMP (P)

20.24' N.E. to iron pin along east edge of pavement

Section 34

Date Established 7/28/2005

Corner SW

Marker Iron Pin

33.00' E. to RR spike (Putnam Co.)

58.84' E.S.E. to "+" in 6" CIP (P)

30.31' S.S.E. to stud in north end of 15" CIP (P)

62.24' S.S.E. to duplex W/side of power pole

Section 34




Date Established 7/28/2005

Corner S¹/₄ SW

Marker RR Spike

11.10' N.W. to 5/8" iron pin along north edge of pavement

11.91' N.E. to 5/8" iron pin along north edge of pavement

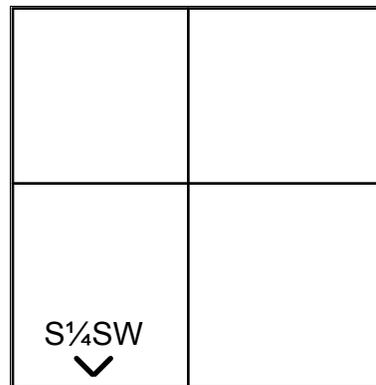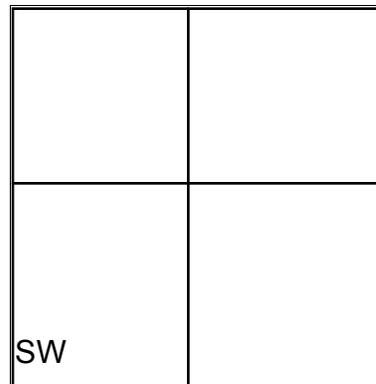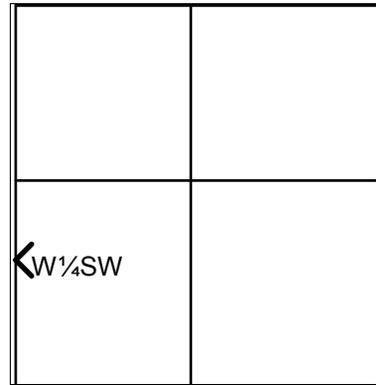

Marion Township

Section 34

Date Established 8/1/2005

Corner S¹/₄

Marker Small RR Spike
37.5 Links (27.75') east of stone

Ties to stone:

24.20' N.E. to "+" NW bridge wing (P)

12.57' S.E. to "+" SW bridge wing (P)


Ties to S¹/₄ Corner:

21.51' N.W. to "+" NW bridge wing (P)

34.82' N.E. to "+" NE bridge wing (P)

28.64' S.E. to "+" SE bridge wing (P)

20.13' S.W. to "+" SW bridge wing (P)

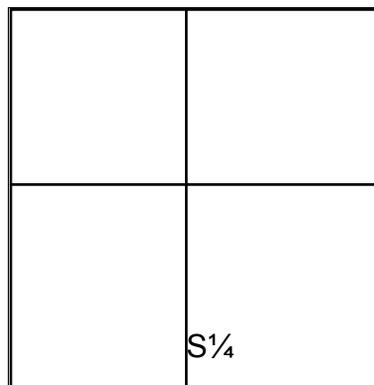

Marion Township

Section 35
Date Established 7/28/2005
Corner NW
Marker Small RR Spike

36.28' N.W. to "+" NE corner of catch basin (P)
49.31' N.E. to nail/shiner SW/side of underground cable marker
37.69' S.W. to "+" in west end of RCP (P)
40.89' E.N.E. to "+" in east end of RCP

NW	

Section 35
Date Established 7/28/2005
Corner N¼
Marker RR Spike

27.97' S.E. to duplex SW/side of power pole
40.43' S.W. to "+" in south end of RCP
38.18' N.W. to "+" in north end of RCP
20.24' N.E. to iron pin along edge of pavement radius

	N¼

Section 35
Date Established 7/28/2005
Corner W¼
Marker Small RR Spike

11.18' S.W. to duplex in NW/side of guard rail post
67.36' S.E. to "+" in northeast corner of catch basin
47.97' S.E. to nail/shiner NW/side of power pole
40.55' N.N.W. to "+" in southwest wing
59.91' N.E. to "+" in southeast wing

W¼	

Marion Township

Section 35

Date Established 7/28/2005

Corner CENTER

Marker RR spike

18.74' E. to duplex S/side of power pole

82.30' S.S.W. to duplex W/side of meter pole

15.75' N.E. to iron pin along east edge of pavement

Section 35

Date Established _____

Corner SW

Marker ODOT Monument Box - Found 7/28/05

Section 35

Date Established 7/28/2005




Corner S¹/₄

Marker RR Spike

28.11' N.W. to 5/8" iron pin mid radius along edge of pavement

35.78' N.E. to 5/8" iron pin

28.25' S. to 5/8" iron pin on south ditch bank (P)

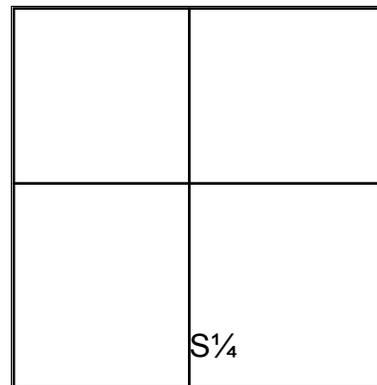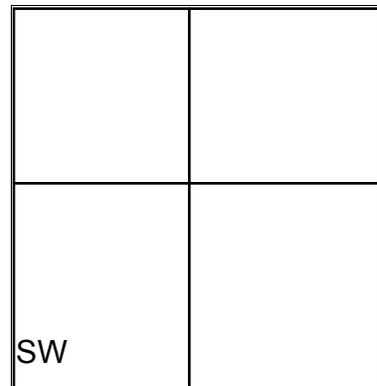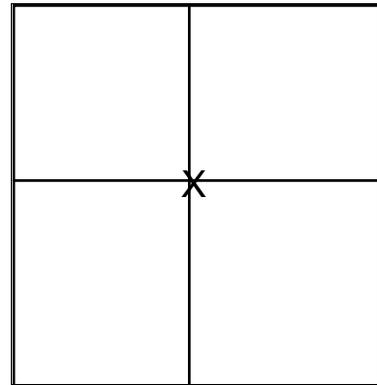

Marion Township

Section 35

Date Established 7/28/2005


Corner S¹/₄ SE

Marker Iron Pin

20.37' N.W. to 5/8" iron pin along north edge of stone road

25.38' N.E. to 5/8" iron pin along north edge of stone road

30.18' S.E. to PK nail north end of 12" plastic pipe (P)

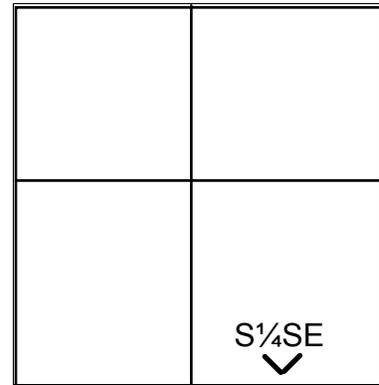

Marion Township

Section 36
Date Established 7/28/2005
Corner NW
Marker RR Spike

36.29' N.W. to duplex NE/side of underground cable marker
29.57' N.W. to "+" north end of RCP (P)
32.78' S.E. to duplex SW/side of power pole
29.40' S.W. to "+" south end of RCP (P)

NW	

Section 36
Date Established 7/28/2005
Corner N¹/₄ NW
Marker RR Spike

17.41' N.E. to 5/8" iron pin along north edge of pavement
123.01' E.S.E. to duplex N/side of power pole
17.25' W.S.W. to 5/8" iron pin at south edge of pavement

N ¹ / ₄ NW	

Section 36
Date Established 7/28/2005
Corner N¹/₄
Marker Iron Pin

37.40' W. to 5/8" iron pin at south edge of pavement
23.45' N.W. to "+" southeast corner of catch basin (P)
25.14' N.E. to 5/8" iron pin along north edge of pavement

	N ¹ / ₄

Marion Township

Section 36

Date Established 7/28/2005

Corner NE

Marker RR Spike

73.72' S.W. to PK in SE/side of power pole

57.55' S.S.W. to duplex in N/side of power pole

43.35' N.W. to "+" in north end of CMP

31.76' N.E. to PK in SE/side of 4" wood fence post

	NE

Section 36

Date Established 7/29/2005

Corner W¹/₄

Marker RR Spike

23.10' N.N.W. to 5/8" iron pin at west edge of pavement

11.60' S.W. to "+" west end of CIP (P)

53.44' S.E. to duplex in SW/side of telephone pole

W ¹ / ₄	

Section 36

Date Established 7/29/2005

Corner E¹/₄

Marker RR Spike

33.18' N.N.W. to duplex E/side of power pole

22.71' S.E. to 5/8" x 24" iron pin along east edge of pavement

174.54' S.S.W. to duplex E/side of power pole

40.67' S. to W¹/₄ Post. Sec. 36. Bartlow Twp.

	E ¹ / ₄

Marion Township

Section 36


Date Established 7/29/2005

Corner W¹/₄ SW

Marker Iron Pin

41.46' N.E. to 5/8" iron pin at east edge of pavement (P)

37.02' S.E. to 5/8" iron pin at east edge of pavement (P)

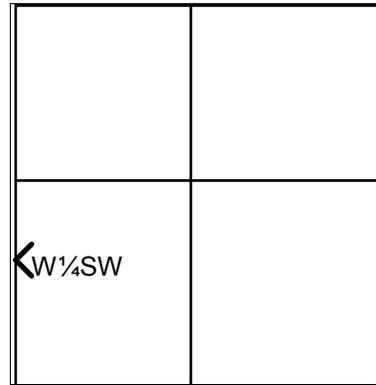

Section 36

Date Established 7/29/2005


Corner SW

Marker RR Spike

31.90' N.W. to "+" north end of RCP (P)

22.57' S.W. to "+" south end of RCP (P)

21.26' S.E. to iron pin along east edge of pavement

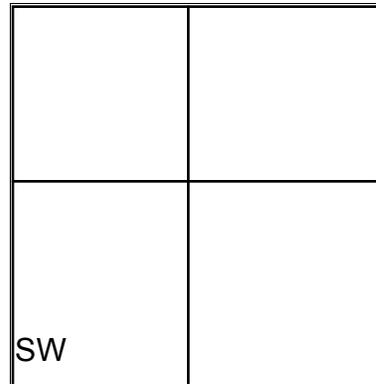

Section 36

Date Established 7/29/2005

Corner S¹/₄

Marker Iron Pin

26.04' N.W. to 5/8" iron pin

28.40' N.E. to 5/8" iron pin

22.15' S.W. to "+" in west end of CIP

