

Monroe Township

Section 1
Date Established 8/29/2007
Corner NW

Marker RR Spike below surface
45.94' SE to "+" east end concrete pipe (P)
15.08' SW to "+" corner of concrete headwall (P)
51.23' NE to duplex SE/side telephone pole (leans south)
46.54' W to Harrison Twp. Corner (iron pipe)

NW	

Section 1
Date Established 8/29/2007
Corner N¼

Marker RR Spike
83.67' WNW to duplex NE/side telephone pole
59.52' ENE to duplex S/side telephone pole
42.02' SSW to duplex W/side power pole
18.95' W to Harrison Twp. Corner (RR Spike)

	N¼

Section 1
Date Established 8/29/2007
Corner NE

Marker RR Spike
29.55' NE to duplex SE/side telephone pole
44.02' SE to duplex NE/side power pole
42.61' SW to duplex NW/side power pole
95.65' NNW to duplex E/side power pole
79.85' SW to NE corner concrete foundation telephone building

	NE

Monroe Township

Section 1

Date Established 8/29/2007

Corner W¹/₄

Marker Iron Pin

PK's 5' NE and SE

22.97' NW to "+" north end steel drive pipe

22.45' SW to "+" north end steel drive pipe

Section 1

Date Established 8/29/2007

Corner E¹/₄

Marker Iron Pin

30.66' W to duplex SW/side power pole

27.13' NW to 5/8" iron pin 1' west of pavement

37.71' SW to 5/8" iron pin 1' west of pavement

W ¹ / ₄	

	E ¹ / ₄

Monroe Township

Section 2

Date Established 8/29/2007

Corner NW

Marker RR Spike

48.00' NE to shiner SW/side power pole

51.27' SE to shiner NW/side power pole

54.50' WSW to "+" in 24" concrete pipe (P)

83.16' W to Harrison Twp. Corner

57.64' NW to "+" SE corner CB (P)

NW	

Section 2

Date Established 8/29/2007

Corner N¼

Marker RR Spike 4" below surface

57.01' SE to "+" north end inlet structure (P)

57.05' WSW to "+" south end concrete pipe (P)

56.27' WNW to "+" north end concrete pipe (P)

21.18' NW to mag nail east end 12" corrugated plastic pipe (P)

59.35' W to Harrison Twp. Corner

	N¼

Section 2

Date Established 8/29/2007

Corner N¼ NE

Marker RR Spike 2" below surface

63.49' ESE to duplex N/side telephone pole

60.85' NW to ¾" iron pin

23.33' SE to mag nail east end 15" corrugated plastic pipe

97.94' WSW to duplex N/side power pole

	N¼NE

Monroe Township

Section 2

Date Established 8/29/2007

Corner W¹/₄

Marker Nail/Shiner

42.42' NW to duplex SW/side power pole

76.33' NE to duplex SE/side power pole

80.18' SSE to nail/shiner NW side power pole (leans west)

26.43' W to 1/2" iron pipe (P)

W ¹ / ₄	

Monroe Township

Section 3

Date Established 8/29/2007

Corner NW

Marker Small RR Spike

55.19' ESE to "+" NE corner CB (P)

29.83' SE to duplex E/side telephone pole

90.65' WSW to duplex S/side telephone pole

29.92' NNW to duplex SE/side brace pole

80.25' WSW to "+" east corner CB

53.55' W to Harrison Twp. Corner (small RR spike)

NW	

Section 3

Date Established 8/29/2007

Corner N¹/₄

Marker Small RR Spike

74.88' ESE to duplex N/side power pole

44.23' WSW to PK nail N/side telephone pole

67.14' W to S¹/₄ Post, Sec. 34, Harrison Twp.

65.57' WSW to "+" NE corner CB (P)

49.12' NW to duplex SW/side power pole

	N ¹ / ₄

Section 3

Date Established 8/29/2007

Corner W¹/₄

Marker Small RR Spike

100.19' SSW to mag nail N/side power pole (P)

20.09' NW to "+" SW corner CB (P)

27.46' W to duplex S/side power pole

W ¹ / ₄	

Monroe Township

Section 4

Date Established 8/29/2007

Corner NW

Marker Harrow Tooth 2" below surface

80.71' ESE to duplex N/side telephone pole

52.91' WSW to duplex NW/side power pole

63.92' WSW to duplex E/side telephone pole

63.82' NE to duplex S/side power pole

59.35' W to Harrison Twp. Corner

38.74' WNW to "+" NW corner CB (P)

NW	

Section 4

Date Established 8/29/2007

Corner N¹/₄

Marker RR Spike

27.43' WSW to duplex N/side telephone pole

14.66' NW to 5/8" iron pin 2' north of pavement

87.88' ENE to duplex S/side power pole

56.49' W to Harrison Twp. Corner (RR Spike)

	N ¹ / ₄

Section 4

Date Established 8/29/2007

Corner N¹/₄ NE

Marker RR Spike

27.87' SE to duplex W/side telephone pole (leaning north)

18.57' SE to "+" NW corner CB (P)

78.84' ENE to duplex S/side power pole

	N ¹ / ₄ NE

Monroe Township

Section 4

Date Established 8/29/2007

Corner W¹/₄

Marker Small RR Spike

38.83' NE to "+" SW/side steel post (2.4' above base)

27.87' SE to 5/8" iron pin 1' east of pavement

64.34' NW to duplex SW/side power pole

32.30' E to duplex S/side wooden corner post

W ¹ / ₄	

Monroe Township

Section 5

Date Established 8/29/2007

Corner NW

Marker Iron Pin 4" below surface

19.31' NNE to PK W/side power pole (new)

69.73' ESE to duplex N/side telephone pole

85.78' SW to duplex N/side power pole

73.54' WSW to duplex NE/side telephone pole

99.04' W to Harrison Twp. Corner

NW	

Section 5

Date Established 8/29/2007

Corner N¹/₄ NW

Marker RR Spike 1" below surface

53.77' NE to duplex S/side power pole

31.50' SE to "+" NW corner CB (P) (new top)

20.80' SSE to duplex E/side telephone pole

79.18' WSW to duplex N/side telephone pole

N ¹ / ₄ NW	

Section 5

Date Established 8/29/2007

Corner N¹/₄

Marker RR Spike 2" below surface

87.46' WNW to PK nail S/side power pole

64.65' WSW to duplex N/side telephone pole (leans north)

77.52' ESE to duplex N/side telephone pole (leans north)

80.26' W to Harrison Twp. Corner (RR Spike)

	N ¹ / ₄

Monroe Township

Section 5

Date Established 8/29/2007

Corner W¹/₄

Marker Iron Pin 1" below surface

24.34' W to duplex N/side power pole

13.17' NE to 5/8" iron pin 1' east of pavement

13.34' SE to 5/8" iron pin 1' east of pavement

36.35' E to mag nail N/side 12" tree

Section 5

Date Established 8/29/2007

Corner W¹/₄ SW

Marker Small RR Spike

17.85' SW to PK nail north end 8" CMP (P)

85.20' SW to NE corner foundation of cage house

47.70' NE to PK nail SW/side of power pole

24.95' E to Iron Pin (property pin)

W ¹ / ₄	

< W ¹ / ₄ SW	

Monroe Township

Section 6

Date Established 8/29/2007

Corner NW

Marker Iron Pipe 3" below surface

29.76' NW to "+" SE corner CB (P)

19.44' N to duplex W/side power pole

44.32' SE to duplex N/side telephone pole

19.86' S to iron pin 1' deep (P)

29.84' SW to "+" NE corner CB (P)

NW	

Section 6

Date Established 8/29/2007

Corner N¹/₄ NW

Marker RR Spike 1" below surface

26.99' NE to duplex SE/side power pole

17.96' S to duplex N/side telephone pole

N ¹ / ₄ NW	

Section 6

Date Established 8/29/2007

Corner N¹/₄

Marker RR Spike 1" below surface

81.55' ESE to duplex N/side telephone pole

66.73' WSW to duplex N/side telephone pole

39.95' NW to mag nail S/side 18" tree

	N ¹ / ₄

Monroe Township

Section 6

Date Established 8/29/2007

Corner N¹/₄ NE

Marker RR Spike 1" below surface

17.82' S to PK nail E/side telephone pole

17.22' NW to 5/8" iron pin 1' north of pavement

16.77' NE to 5/8" iron pin 1' north of pavement

	^ N ¹ / ₄ NE

Monroe Township

Section 7

Date Established 8/30/2007

Corner NW

Marker RR Spike 1" below surface

13.30' SE to 5/8" iron pin 1' south of pavement

20.90' S to PK nail W/side of wood post

10.63' SW to 5/8" iron pin 1' south of pavement

78.10' ENE to duplex N/side power pole

16.58' N to Flatrock Twp. corner (iron pin)

NW	

Section 7

Date Established 8/30/2007

Corner N¼

Marker RR Spike 1" below surface

36.87' NW to duplex S/side power pole

31.87' ESE to "+" SW corner CB (P)

47.93' SW to mag nail NW root large tree

	N¼

Section 7

Date Established 8/30/2007

Corner N¼ NE

Marker RR Spike 1" below surface

11.30' NE to 5/8" iron pin 1' north of pavement

52.57' WSW to duplex N/side power pole

18.83' N to duplex W/side wood post

44.29' WNW to mag nail west end corrugated plastic drive pipe

	N¼NE

Monroe Township

Section 8

Date Established 8/30/2007

Corner NW

Marker RR Spike 1" below surface

42.46' NW to duplex S/side wood telephone post

52.35' NNE to duplex SW/side telephone pole

33.55' SW to duplex E/side power pole

49.97' NE to duplex SE/side power pole

37.97' NW to duplex SW/side power pole

NW	

Section 8

Date Established 8/30/2007

Corner N¹/₄ NW

Marker RR Spike 2" below surface

46.40' NW to "+" SE corner CB cover (P)

48.20' NE to duplex NW/side wood telephone post

52.38' SE to duplex NE/side power pole

33.18' SW to "+" NE corner CB cover (P)

N ¹ / ₄ NW	

Section 8

Date Established 8/30/2007

Corner N¹/₄

Marker RR Spike

25.85' NW to "+" SE corner CB (P)

40.96' SE to "+" east end concrete pipe (P)

45.31' SW to "+" west end concrete pipe (P)

72.27' NE to duplex NW/side telephone post

	N ¹ / ₄

Monroe Township

Section 8

Date Established 8/30/2007

Corner W¹/₄

Marker RR Spike 1" below surface

15.91' NE to 5/8" iron pin 1' east of pavement

30.30' SE to 5/8" iron pin 1' east of pavement

19.87' WSW to "+" in CMP (P)

15.79' ESE to mag nail east end corrugated helical pipe (P)

Section 8

Date Established 8/30/2007



Corner CENTER

Marker Small RR Spike

14.70' E to duplex S/side power pole

15.69' W to duplex N/side power pole

34.52' NE to duplex S/side mail box post

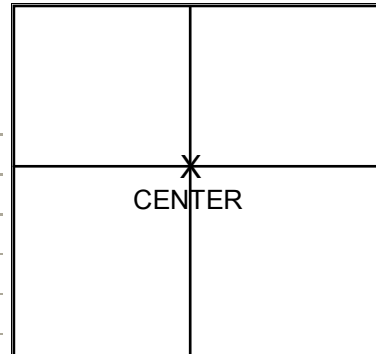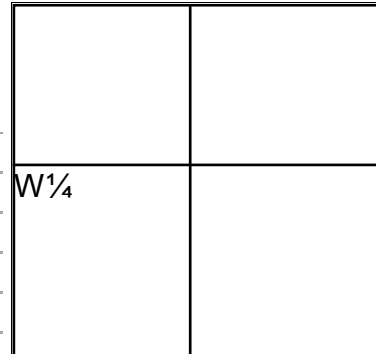

Monroe Township

Section 9

Date Established 8/30/2007

Corner NW

Marker RR Spike

35.18' NW to "+" north end concrete pipe (P)

38.31' NE to "+" NW corner CB lid (P)

34.31' SW to "+" south end concrete pipe (P)

39.04' SE to "+" NE/side CB (P)

45.18' SE to duplex SW/side power pole

NW	

Section 9

Date Established 8/30/2007

Corner N¹/₄

Marker Iron Pin 6" below surface. Place small RR Spike on surface

46.27' NW to "+" in center south wall of CB (P)

45.35' ESE to "+" NW corner CB lid (P)

39.02' SE to duplex NE/side power pole (New)

45.04' WSW to "+" NE corner CB lid (P)

	N ¹ / ₄

Section 9

Date Established 8/30/2007

Corner W¹/₄

Marker RR Spike

64.13' SSE to "+" NW corner CB (P)

60.64' SSW to bolt in animal guard of 6" N12 pipe (P)

18.97' NE to 5/8" iron pin at east edge of pavement

W ¹ / ₄	

Monroe Township

Section 9

Date Established 8/30/2007

Corner CENTER

Marker Small RR Spike

10.25' NW to 5/8" iron pin 1' west of pavement

10.39' NE to 5/8" iron pin 1' east of pavement

79.04' NNE to duplex W/side power pole



Monroe Township

Section 10

Date Established 8/30/2007

Corner NW

Marker RR Spike

33.74' NW to "+" north end concrete pipe (P)

39.10' NE to duplex W/side telephone pole

34.60' SSW to "+" south end concrete pipe (P)

41.90' SW to PK nail NW/side power pole

51.58' SE to "+" NW/side CB

NW	

Section 10

Date Established 8/30/2007

Corner N¹/₄

Marker RR Spike

28.90' N to duplex W/side power pole

31.17' S to duplex E/side power pole

19.00' SW to 5/8" iron pin 2' south of pavement

41.65' NW to "+" SE corner concrete drive

	N ¹ / ₄

Section 10

Date Established 8/30/2007

Corner W¹/₄

Marker Small RR Spike

23.61' ESE to "+" center north wall CB (P)

59.11' SSW to "+" north end concrete headwall

23.00' WSW to duplex N/side power pole

45.85' NNW to mag nail north end drive pipe

W ¹ / ₄	

Monroe Township

Section 11

Date Established 8/30/2007

Corner NW

Marker Nail/Shiner

40.74' NNE to "+" north end concrete headwall

47.30' NE to shiner SW/side power pole

42.90' ESE to "+" SW corner CB lid (P)

32.66' SW to shiner NE/side light pole

82.69' SSW to duplex W/side power pole

NW	

Section 11

Date Established 8/30/2007

Corner N¹/₄

Marker RR Spike

77.70' ENE to duplex SW/side power pole

80.10' ESE to 30d spike SW/side power pole

27.03' SE to duplex SW/side wood telephone post

27.25' SSW to duplex E/side power pole (new)

	N ¹ / ₄

Section 11

Date Established 8/30/2007

Corner W¹/₄

Marker RR Spike

31.54' NW to "+" NW corner CB (P)

51.77' NE to corner house foundation (126 Turkeyfoot)

31.96' NE to shiner S/side brace pole

35.04' SE to shiner NW/side power pole

25.19' WSW to shiner E/side light pole

W ¹ / ₄	

Monroe Township

Section 11

Date Established 8/30/2007

Corner CENTER


Marker Iron Pin 6" below grade

6' NE & NW to mag nails

27.03' NW to 5/8" iron pin 1' north of pavement

23.70' NE to 5/8" iron pin 1' north of pavement

46.27' ESE to barge spike in conc. encasement, NW culvert wing(P)

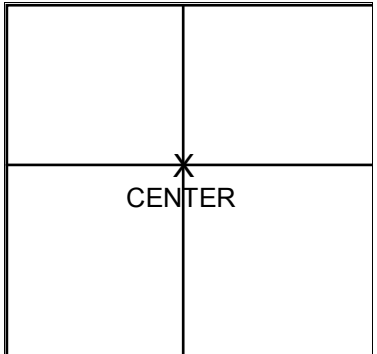

Monroe Township

Section 12

Date Established 8/30/2007

Corner NW

Marker Small RR Spike 2" below surface

43.89' SW to duplex SE/side power pole

50.66' NE to "+" in north end RCP

48.15' NW to "+" in SE corner CB

51.06' SE to "+" in south end RCP

NW	

Section 12

Date Established 8/30/2007

Corner N¼

Marker Iron Pin 6" deep. Set Small RR Spike on surface

21.96' N to duplex W/side power pole

27.86' NE to PK east end CMP (P)

22.74' WSW to 5/8" iron pin 2' south of pavement

	N¼

Section 12

Date Established 8/30/2007

Corner NE

Marker RR Spike 4" below road surface, 7.92' north of section corner

51.10' NW to center of USGS bench mark tablet (P)

49.01' NE to "+" north end CMP arch (P)

32.25' SE to "+" northeast corner CB (P)

55.11' SSW to "+" south end CMP arch (P)

	NE

Monroe Township

Section 12

Date Established 8/30/2007

Corner NE


Marker RR Spike on surface. RR Spike at section corner.

57.92' NW to center of USGS bench mark tablet (P)

56.12' NE to "+" north end CMP arch (P)

29.25' SE to "+" northeast corner CB (P)

47.51' SSW to "+" south end of CMP arch (P)

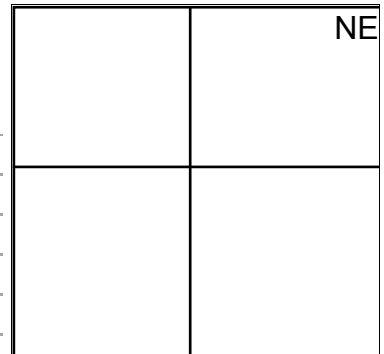

Section 12

Date Established 8/30/2007

Corner W¹/₄

Marker RR Spike 2" below surface


48.32' NW to duplex SW/side telephone pole

40.94' NE to "+" north end concrete pipe (P)

47.80' NE to duplex SE/side power pole

32.60' SE to "+" south end concrete pipe (P)

38.69' SW to "+" west end concrete pipe (P)

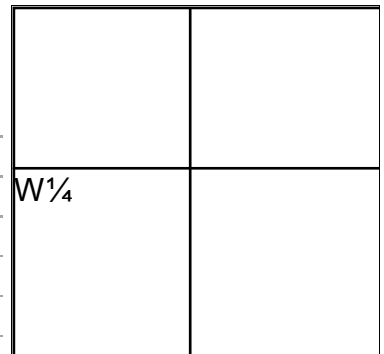

Section 12

Date Established 8/30/2007


Corner CENTER

Marker Small RR Spike

18.77' NNW to 3/4" dia. witness pin (P)

20.17' ESE to 7/8" o.d. witness pipe (P)

22.64' WSW to 7/8" o.d. witness pipe (P)

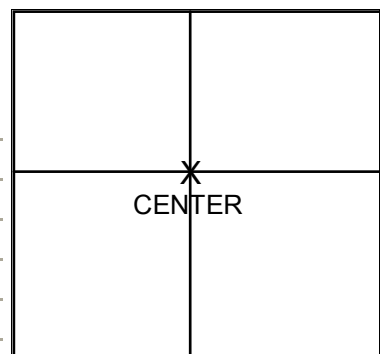

Monroe Township

Section 12

Date Established 8/30/2007

Corner E¹/₄

Marker RR Spike 3" below surface

42.25' NW to "+" west end concrete headwall (P)

37.68' NNW to "+" east end concrete headwall (P)

44.79' SE to 30d spike W/side power pole

27.94' SSW to "+" east end concrete headwall (P)

35.74' SW to "+" west end concrete headwall (P)

	E ¹ / ₄

Monroe Township

Section 13

Date Established 8/30/2007

Corner NW

Marker RR Spike 2" below surface

23.60' SW to "+" top center concrete headwall (P)

50.77' NE to "+" in north end RCP

42.92' SE to "+" in south end RCP

NW	

Section 13

Date Established 8/30/2007

Corner N¼

Marker Small RR Spike

23.99' NNW to "+" west end concrete pipe (P)

27.51' NE to "+" east end concrete pipe (P)

28.96' S to center USGS triangulation station tablet

35.01' SW to "+" east end concrete headwall (P)

	N¼

Section 13

Date Established 8/30/2007

Corner NE

Marker RR Spike 3" below surface

46.01' NW to center USGS Station "Taylor 2 1963" (P)

33.99' NNW to "+" north end concrete pipe (P)

51.57' SE to 16d spike SW/side power pole

37.50' SSW to "+" south end concrete pipe (P)

	NE

Monroe Township

Section 13

Date Established 8/30/2007

Corner W¹/₄

Marker RR Spike 1" below surface

18.83' NW to 5/8" iron pin 5' west of pavement

63.20' NE to duplex NE/side power pole (new)

22.02' SE to PK in CMP 2.5' from east end (P)

W ¹ / ₄	

Section 13

Date Established 8/30/2007

Corner E¹/₄

Marker Iron Pin 6" below edge of pavement

29.36' E to "+" southwest corner CB (P)

63.64' SE to duplex NE/side power pole

36.66' NE to 5/8" iron pin 2.5' east of east edge of pavement

64.07' S to Richfield Twp. Stone

24.01' E to center USGS Station "Couch 194?" (buried)

	E ¹ / ₄

Monroe Township

Section 14

Date Established 8/30/2007

Corner NW

Marker Shaft of Nail

46.96' SW to shiner NE/side power pole

55.50' NW to "+" in east bonnet bolt

39.26' SE to nail/shiner NW/side telephone pole

48.32' WSW to "+" in SE corner CB lid

28.29' SE to "+" in NE corner CB lid

NW	

Section 14

Date Established 8/30/2007

Corner N¼

Marker Iron Pin 6" below edge of pavement

26.31' NW to 5/8" iron pin 1' north of pavement

23.59' NE to 5/8" iron pin 1' north of pavement

	N¼

Section 14

Date Established 8/30/2007

Corner W¼ NW

Marker Nail/Shiner

30.08' ENE to shiner W/side telephone pole

57.63' SW to duplex NE/side power pole

75.48' SE to duplex W/side telephone pole

←W¼NW	

Monroe Township

Section 14

Date Established 8/30/2007


Corner W¹/₄

Marker Nail/Shiner

30.05' SW to shiner NE/side power pole

35.46' NW to duplex E/side 1st wood GR anchor assembly post

50.31' NE to shiner in SW/side telephone pole

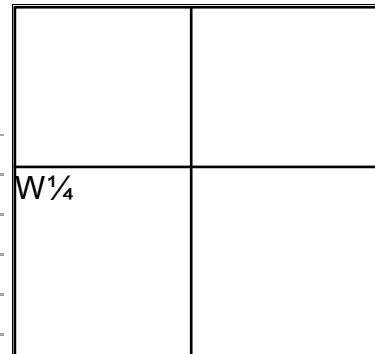

Section 14

Date Established 1/7/1979


Corner CENTER

Marker Iron Pipe

21.65' ESE to "+" north end east headwall (P) (1979 Ties)

9.73' SE to "+" north end west headwall (P) (1979 Ties)

14.82' SSE to "+" south end west headwall (P) (1979 Ties)

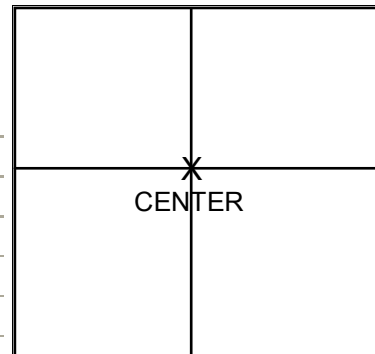

Monroe Township

Section 15

Date Established 8/30/2007

Corner NW

Marker Small RR Spike

28.88' NW to "+" north end CMP (P)

32.92' SE to punch mark in east end CMP (P)

21.93' SW to "+" in concrete wing (P)

31.89' SW to spike SE/side power pole

NW	

Section 15

Date Established 8/30/2007

Corner N¹/₄

Marker Rebar 8" below edge of pavement

42.17' NW to "+" center east wall CB (P)

40.57' SW to "+" NE corner catch basin (P)

	N ¹ / ₄

Section 15

Date Established 8/30/2007

Corner W¹/₄

Marker Iron Pipe

52.86' SW to 5/8" iron pin on west ditch bank

30.38' NE to 5/8" iron pin 1' east of east edge of pavement

32.58' SE to 5/8" iron pin 1' east of east edge of pavement

W ¹ / ₄	

Monroe Township

Section 16

Date Established 9/4/2007

Corner NW

Marker RR Spike

41.65' SE to 30d spike SW/side power pole

31.55' SE to "+" east end concrete pipe (P)

26.46' SW to "+" south end concrete pipe (P)

32.63' NW to "+" north end RCP (P)

24.59' SW to "+" west end RCP (P)

NW	

Section 16

Date Established 9/4/2007

Corner N¹/₄

Marker Small RR Spike

31.63' NW to 5/8" iron pin 2' from pavement radius

64.57' NE to duplex N/side buried cable marker

23.69' S to duplex E/side power pole

77.92' NNE to duplex E/side power pole

	N ¹ / ₄

Section 16

Date Established 9/4/2007

Corner W¹/₄

Marker RR Spike

19.53' ESE to "+" SE corner CB (P)

26.62' SE to duplex S/side 15" hickory

83.15' SSW to nail/shiner SE/side power pole

10.76' W to "+" in east wall CB (P)

W ¹ / ₄	

Monroe Township

Section 17

Date Established 9/4/2007

Corner NW

Marker Iron Pin 1" below surface

26.90' SE to "+" north end concrete headwall (P)

25.37' SW to "+" north end concrete headwall (P)

30.27' NW to duplex SE/side power pole

48.48' SW to duplex NW/side power pole

NW	

Section 17

Date Established 9/4/2007

Corner N¹/₄

Marker Small RR Spike

54.75' WNW to duplex NE/side power pole

48.24' NNW to "+" north end concrete headwall (P)

37.31' NNE to "+" center east wall CB (P)

31.66' SE to "+" NE corner CB (P)

24.92' SW to mag nail west end plastic tile (P)

	N ¹ / ₄

Section 17

Date Established 9/4/2007

Corner W¹/₄

Marker RR Spike 3" below surface

25.35' NE to 5/8" iron pin 1' east of pavement

26.93' SE to 5/8" iron pin 1' east of pavement

18.58' SW to PK in 24" N12 (2' east of west end)

W ¹ / ₄	

Monroe Township

Section 17

Date Established 9/4/2007


Corner CENTER

Marker Small RR Spike

14.43' W to rivet west end CMP (P)

18.29' E to "+" SW corner CB

15.39' SE to 5/8" iron pin 1' east of pavement

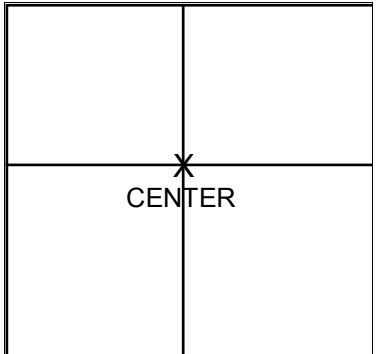

Monroe Township

Section 18

Date Established 9/4/2007

Corner NW

Marker Small RR Spike

83.61' ENE to "+" SW corner CB (P)

58.90' ESE to "+" SW corner CB (P)

15.80' N to Flatrock Twp. Corner (iron pipe)

20.52' S to duplex N/side power pole

NW	

Section 18

Date Established 9/4/2007

Corner N¼

Marker Small RR Spike

28.22' NW to 5/8" iron pin 0.5' north of pavement

12.55' NE to 5/8" iron pin 0.5' north of pavement

30.06' SW to "+" NW corner CB (P)

28.42' SE to mag nail W/side 15" walnut

94.61' WSW to duplex N/side power pole

	N¼

Monroe Township

Section 19

Date Established 9/4/2007

Corner NW

Marker Small RR Spike

28.88' N to duplex W/side power pole

40.34' WSW to NE corner concrete base of Austermilller headstone

5.16' N to Flatrock Twp. Corner (RR Spike)

24.57' SE to NW upper corner concrete base Cassie Bilow headstone

NW	

Section 19

Date Established 9/4/2007

Corner N¼

Marker Small RR Spike

19.43' NNE to duplex W/side power pole

38.27' SSE to duplex W/side power pole

57.50' SW to duplex NW/side power pole

	N¼

Monroe Township

Section 20

Date Established 9/4/2007

Corner NW

Marker RR Spike

38.37' NW to "+" north end CMP (P)

38.06' NW to PK nail SW/side power pole

36.21' SE to "+" east end CMP (P)

30.30' SE to PK nail NW/side power pole

28.27' SW to "+" south end CMP (P)

NW	

Section 20

Date Established 9/4/2007

Corner N¼

Marker Small RR Spike

34.92' NW to "+" NE corner CB

28.73' SE to duplex E/side power pole (new)

31.37' NE to 5/8" iron pin at mid radius, 3' off edge of pavement

58.84' SW to "+" east end backwall of ag inlet

	N¼

Section 20

Date Established 9/4/2007

Corner W¼

Marker RR Spike

17.17' NE to 5/8" iron pin 0.5' east of pavement

17.61' SE to 5/8" iron pin 0.5' east of pavement

24.52' WSW to PK west end plastic pipe

56.62' W to "+" center of back wall of ag inlet

W¼	

Monroe Township

Section 21

Date Established 9/4/2007

Corner NW

Marker RR Spike 3" below surface

28.23' SE to "+" north end headwall (P)

35.76' SE to "+" south end headwall (P)

27.86' SW to "+" south end headwall (P)

18.59' SW to "+" north end headwall (P)

38.40' NE to duplex SW/side 33" tree

NW	

Section 21

Date Established 9/4/2007

Corner N¹/₄

Marker PK Nail 6' south of north edge of pavement

22.46' NW to "+" north end concrete pipe (P)

19.63' S to "+" east end concrete headwall (P)

32.52' SW to "+" west end concrete headwall (P)

	N ¹ / ₄

Section 21

Date Established 9/4/2007

Corner W¹/₄

Marker Small RR Spike

31.83' SE to "+" NE corner CB (P)

27.65' SW to "+" north end concrete headwall (P)

21.27' NE to 5/8" iron pin at edge of pavement

W ¹ / ₄	

Monroe Township

Section 22

Date Established 9/4/2007

Corner NW

Marker RR Spike

31.50' NW to "+" north end concrete pipe (P)

98.30' NE to "+" west end concrete step

27.05' SW to "+" south end concrete pipe (P)

NW	

Section 22

Date Established 9/4/2007

Corner N¼

Marker Iron Pin 8" below surface, 6" south of south edge of pavement

29.24' NE to 5/8" iron pin 1' north of pavement (new)

54.17' WSW to duplex N/side power pole

29.19' NW to 5/8" iron pin 1' north of pavement

	N¼

Section 22

Date Established 9/4/2007

Corner OTHER

Marker RR Spike 2" below surface

25.87' NW to 5/8" iron pin 1' north of pavement

26.62' NE to 5/8" iron pin 1' north of pavement

42.65' SW to duplex NW/side power pole

	25 ± AC

Monroe Township

Section 22

Date Established 9/4/2007

Corner W¹/₄

Marker Iron Pin 5" below surface

36.33' NE to 5/8" iron pin 1' east of pavement

30.25' ESE to "+" SE corner CB (P)

29.08' SE to 5/8" iron pin 1' east of pavement

33.95' SW to "+" south end metal drive pipe

19.48' SW to "+" south end metal drive pipe

W ¹ / ₄	

Monroe Township

Section 23

Date Established 9/4/2007

Corner NW


Marker Mag Nail

33.32' NE to "+" in bridge abutment cap

23.23' ESE to "+" in bridge abutment cap

54.79' WSW to "+" in bridge abutment cap

59.80' WNW to "+" in bridge abutment cap

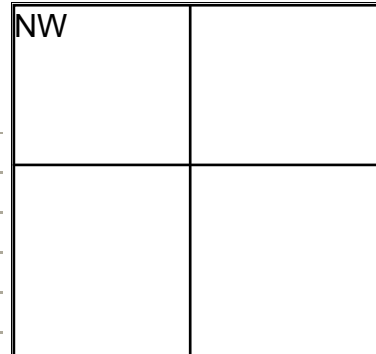

Section 23

Date Established 9/4/2007


Corner OTHER

Marker Iron Pin

27.76' NE to 5/8" iron pin 1' north of north edge of pavement

27.34' NW to 5/8" iron pin 1' north of north edge of pavement

67.5'± E to center west rail

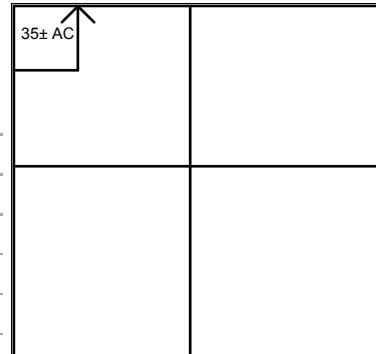

Section 23


Date Established 9/4/2007

Corner N¼

Marker Small RR Spike

14.36' SE to iron pin on ditch bank (P)

14.98' SW to iron pin on ditch bank (P)

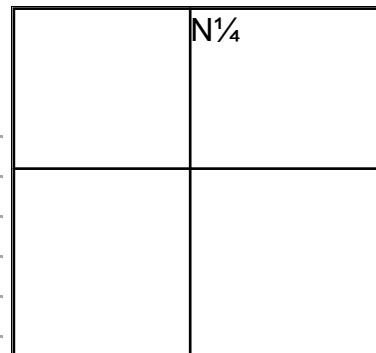

Monroe Township

Section 23

Date Established 9/4/2007

Corner W¹/₄

Marker PK Nail/Shiner

31.78' WNW to center R/W monument (P)

31.68' ENE to center R/W monument (P)

29.91' E to shiner W/side telephone pole

30.75' SSW to "+" NE/corner CB (P)

W ¹ / ₄	

Monroe Township

Section 24

Date Established 9/4/2007

Corner NW

Marker Small RR Spike

49.39' SE to duplex NE/side power pole (new)

41.46' SW to "+" in west end RCP

31.95' ESE to "+" in east end headwall

27.33' SE to "+" in headwall

NW	

Section 24

Date Established 9/4/2007

Corner N¼

Marker Small RR Spike

25.05' NW to PK nail north end N12 (P)

26.13' N to duplex W/side wood corner post

105.20' SW to duplex SE/side power pole (new)

35.89' SW to mag nail west end drive pipe (P)

14.82' S to PK nail south end 12" N12 pipe 1' north of pipe end

	N¼

Section 24

Date Established 9/4/2007

Corner NE

Marker RR Spike

63.58' WNW to duplex S/side telephone pole

48.17' NW to "+" north end concrete pipe (P)

60.74' SE to center USGS Bench Mark "F117 1947"

43.67' SW to "+" south end concrete pipe (P)

27.27' NE to duplex S/side power pole

60.85' S to Richfield Twp. Corner

	NE

Monroe Township

Section 24

Date Established 9/4/2007

Corner W¹/₄

Marker Iron Pin and PK Nail Northeast. Reset Iron Pin.

Set Mag Nails 6' SW and NE

21.99' W to "+" N/side concrete corner post

36.27' NW to duplex SW/side power pole

33.32' NE to duplex NW/side power pole

23.09' E to "+" W/side concrete corner post

32.70' ESE to duplex SW/side power pole

W ¹ / ₄	

Section 24

Date Established 9/4/2007

Corner E¹/₄

Marker RR Spike

22.45' NNW to 5/8" iron pin 1' west of pavement

25.08' SSW to 5/8" iron pin 1' west of pavement

58.38' S to Richfield Twp. Corner

64.98' SE to duplex SW/side power pole

	E ¹ / ₄

Monroe Township

Section 25

Date Established 9/4/2007

Corner NW

Marker Nail/Shiner

52.53' SE to shiner NW/side power pole

38.48' SE to "+" SE corner CB (P)

41.80' SW to "+" in center north wall CB (P)

54.29' SW to "+" south end concrete headwall (P)

1.88' N to nail/shiner

NW	

Section 25

Date Established 9/4/2007

Corner N¹/₄ NW

Marker Headless Nail

61.46' ESE to "+" NW corner concrete drive (P)

51.83' SE to nail/shiner NW/side power pole

26.37' S to PK nail west end CMP (P)

N ¹ / ₄ NW	

Section 25

Date Established 9/4/2007

Corner NE

Marker Iron Pin 12" below berm

37.05' NW to shiner SE/side power pole

89.30' NE to duplex W/side power pole

38.33' SE to center USGS Bench Mark "E117 1947" (P)

27.64' SSW to "+" in curb of bridge rail

24.96' SSW to "+" in NE wing of bridge

	NE

Monroe Township

Section 25

Date Established 9/4/2007

Corner W¹/₄

Marker Small RR Spike

17.54' NW to 5/8" iron pin 4' west of pavement

96.31' SSE to duplex E/side power pole

102.30' SSW to duplex E/side power pole

16.72' SW to 5/8" iron pin 4' west of pavement

W ¹ / ₄	

Section 25

Date Established 9/4/2007

Corner E¹/₄

Marker RR Spike at west edge of pavement, 1" below surface

43.12' S to W¹/₄ Post, Sec. 30, Richfield Twp.

28.70' SE to 5/8" iron pin 1' east of pavement

56.04' SE to duplex N/side power pole

74.23' SE to "+" NW/corner CB (P)

69.40' SSW to "+" west end concrete pipe (P)

52.43' WSW to mag nail N/side 10" pine tree

	E ¹ / ₄

Monroe Township

Section 26

Date Established 9/4/2007

Corner NW

Marker RR Spike 2" below surface

61.57' SSW to "+" south end concrete pipe (P)

48.68' SW to "+" NE corner CB (P)

43.63' SW to duplex SE/side power pole

55.01' SE to "+" SE corner concrete base

51.05' NE to "+" SW corner Stop sign base

53.99' NW to "+" north end RCP (P)

NW	

Section 26

Date Established 9/4/2007

Corner N¹/₄

Marker PK Nail

39.35' N to "+" S/side concrete anchor post

42.75' NE to "+" center east wall CB (P)

47.12' SW to iron pin in concrete monument (P) (bent)

	N ¹ / ₄

Section 26

Date Established 9/4/2007

Corner W¹/₄

Marker Nail/Shiner 1' east of west edge of pavement

28.87' W to duplex N/side power pole

36.48' E to duplex W/side wood post

34.99' ESE to "+" center south wall CB (P)

W ¹ / ₄	

Monroe Township

Section 27

Date Established 9/4/2007

Corner NW

Marker Headless Nail

53.75' NW to SE corner CB (P)

53.32' SW to duplex E/side power pole (new)

48.22' NW to "+" NW corner concrete box (P)

40.16' SW to "+" south end concrete wingwall (P)

NW	

Section 27

Date Established 9/4/2007

Corner N¹/₄

Marker Nail/Shiner

77.79' WNW to duplex SW/side power pole

28.66' N to "+" SW corner CB (P)

73.85' SW to shiner NW/side power pole

	N ¹ / ₄

Section 27

Date Established 9/4/2007

Corner W¹/₄

Marker Small RR Spike

22.78' NE to 5/8" iron pin

20.98' SE to 5/8" iron pin

90.51' SSE to duplex NE/side buried cable marker

49.84' SW to PK nail west end 10" CMP (P)

35.34' WSW to duplex S/side power pole

W ¹ / ₄	

Monroe Township

Section 28

Date Established 9/5/2007

Corner NW

Marker Nail/Shiner

52.35' NE to shiner in buried cable marker

42.62' SE to "+" east end concrete pipe (P)

56.26' SE to shiner N/side 12" pine tree

49.41' SW to "+" west end concrete pipe

54.48' SW to duplex NE/side power pole

NW	

Section 28

Date Established 9/5/2007

Corner N¹/₄

Marker PK Nail

28.74' N to "+" SW corner CB (P)

27.36' SE to "+" north end concrete headwall (P)

27.28' S to "+" NW corner CB (P)

	N ¹ / ₄

Section 28

Date Established 9/5/2007

Corner W¹/₄

Marker RR Spike 6" deep. Placed Small RR Spike on surface

23.22' W to PK nail in north end 12" CMP

24.84' SW to 5/8" iron pin 1' west of west edge of pavement

16.66' NW to 5/8" iron pin 1' west of west edge of pavement

W ¹ / ₄	

Monroe Township

Section 29

Date Established 9/5/2007

Corner NW

Marker PK Nail

48.87' NW to "+" north end concrete pipe (P)

42.94' NE to nail/shiner S/side telephone pole

50.53' SW to nail/shiner NE/side power pole

43.52' SW to "+" south end concrete pipe (P)

54.08' SE to "+" east end RCP (P)

NW	

Section 29

Date Established 9/5/2007

Corner N¹/₄

Marker Nail/Shiner

31.83' NW to PK nail west end 12" N12 pipe

42.22' NE to PK nail east end 12" N12 pipe

39.42' S to face of plastic post

48.80' NW to "+" NE corner CB (P)

	N ¹ / ₄

Section 29

Date Established 9/5/2007

Corner W¹/₄

Marker RR Spike

49.83' NW to 5/8" iron pin on west ditch bank

42.84' SW to 5/8" iron pin on west ditch bank

19.26' NE to 5/8" iron pin 1' east of edge of pavement

W ¹ / ₄	

Monroe Township

Section 30

Date Established 9/5/2007

Corner NW

Marker Nail/Shiner

57.30' NW to "+" top concrete headwall

51.03' N to shiner S/side power pole

26.57' SE to "+" north end concrete headwall (P) (new)

55.12' SW to "+" south wall CB (P)

35.72' NNE to "+" in SW corner CB

NW	

Section 30

Date Established 9/5/2007

Corner N¼

Marker Nail/Shiner

41.56' NW to "+" SE corner CB (P)

35.66' SE to PK nail north end 12" CMP (P)

36.19' SW to "+" south end concrete pipe (P)

44.72' S to duplex W/side wood fence post

	N¼

Monroe Township

Section 31

Date Established 9/5/2007

Corner NW

Marker Small RR Spike

29.16' NNE to "+" north end concrete pipe (P)

35.45' ESE to "+" south end concrete pipe (P)

26.75' SW to PK nail west end 12" N12 pipe

14.30' N to Flatrock Twp. Corner (RR Spike)

NW	

Section 31

Date Established 9/5/2007

Corner N¼

Marker RR Spike 6" deep. Set Small RR Spike on surface

21.04' N to PK nail north end 12" N12 pipe

12.83' S to PK nail south end 12" N12 pipe

83.59' ENE to duplex N/side power pole

16.12' NW to 5/8" iron pin 1' north of pavement

6.00' E to offset stone (Small RR Spike)

	N¼

Section 31

Date Established 9/5/2007

Corner OTHER

Marker Small RR Spike 6' east of corner

14.72' SW to PK nail south end 12" plastic tile

22.35' NW to PK nail south end 12" plastic tile

20.84' NW to 5/8" iron pin 1' north of edge of pavement

77.81' ENE to duplex N/side power pole (new)

6.00' W to Section Corner

	RR Spike 6' East of N¼

Monroe Township

Section 31

Date Established 9/5/2007

Corner SW

Marker Small RR Spike

59.40' WNW to shiner SE/side power pole (near ground level)

35.65' N to shiner S/side 12" maple

44.92' NE to shiner SW/side 15" maple

33.95' SW to PK nail north end 18" CMP (P)

Section 31

Date Established 9/5/2007

Corner S¹/₄

Marker Small RR Spike

77.99' E to N¹/₄ Post, Sec. 6, Marion Twp. (Small RR Spike)

96.44' WNW to shiner E/side power pole

25.50' NE to 5/8" iron pin 1' north of edge of pavement

82.48' ESE to "+" NW corner concrete anchor post

SW

S¹/₄

Monroe Township

Section 32

Date Established 9/5/2007

Corner NW

Marker Small RR Spike

42.66' NW to duplex S/side power pole

50.90' SE to "+" east end concrete pipe (P)

85.53' SW to duplex E/side power pole

41.02' SW to "+" west end concrete pipe

NW	

Section 32

Date Established 9/5/2007

Corner N¼

Marker Small RR Spike

15.01'NW to 5/8" iron pin 1' north of pavement

14.43' SW to 5/8" iron pin 1' south of pavement

72.27' WNW to duplex S/side power pole

15.04' NE to 5/8" iron pin 1' north of pavement

	N¼

Section 32

Date Established 9/5/2007

Corner W¼ NW

Marker Small RR Spike

14.70' NW to 5/8" iron pin 3' west of pavement

15.82' SW to 5/8" iron pin 3' west of pavement

29.90' ESE to "+" in SE corner CB

← W¼NW	

Monroe Township

Section 32

Date Established 9/5/2007

Corner W¹/₄

Marker RR Spike 8" deep. Set Small RR Spike on surface

22.10' SE to 5/8" iron pin (new) 3' east of pavement

13.37' SW to 5/8" iron pin 3' west of pavement

27.13' W to duplex S/side power pole

13.52' WNW to "+" in concrete GR base

42.47' NE to "+" in concrete GR base

29.48' E to "+" NE corner CB (P)

W ¹ / ₄	

Section 32

Date Established 9/5/2007

Corner SW

Marker Small RR Spike

51.04' NE to shiner S/side power pole

65.73' E to Marion Twp. Corner (Small RR Spike)

31.48' NW to 5/8" iron pin mid radius 1' off edge of pavement (P)

14.76' SW to 5/8" iron pin 2' south of edge of pavement

SW	

Section 32

Date Established 9/5/2007

Corner S¹/₄

Marker Small RR Spike

22.85' NW to 5/8" iron pin 1' north of pavement

31.05' N to duplex E/side meter pole

30.12' N to shiner SE/side power pole

26.65' SE to 5/8" iron pin 1' south of pavement

	S ¹ / ₄

Monroe Township

Section 33

Date Established 9/5/2007

Corner NW

Marker Small RR Spike

27.77' WNW to "+" in NE wingwall

39.35' NNE to duplex SE/side telephone pole

40.24' SE to "+" east end concrete pipe (P)

23.91' WSW to "+" in SE wingwall

67.16' ENE to duplex west side power pole

NW	

Section 33

Date Established 9/5/2007

Corner N¹/₄

Marker Small RR Spike 1" below surface

15.12' NE to 5/8" iron pin 1' north of pavement

12.41' SE to 5/8" iron pin 1' south of pavement

16.10' NW to 5/8" iron pin 1' north of pavement

	N ¹ / ₄

Section 33

Date Established 9/5/2007

Corner W¹/₄

Marker Small RR Spike

36.92' W to duplex E/side power pole (new nail)

20.51' W to "+" top RCP (P)

58.93' ESE to PK nail W/side power pole

26.91' NE to 5/8" iron pin 1' east of pavement

W ¹ / ₄	

Monroe Township

Section 33

Date Established 9/5/2007

Corner SW

Marker Small RR Spike

43.42' NW to shiner SE/side power pole

27.11' NW to "+" north end concrete pipe (P)

29.79' SW to "+" south end concrete pipe (P)

31.52' E to Marion Twp. Corner (Small RR spike)

37.35' SSE to duplex W/side south GR post

SW

Section 33

Date Established 9/5/2007

Corner S¹/₄

Marker Small RR Spike

35.39' NW to shiner SE/side power pole

18.47' NNE to "+" north end concrete pipe (P)

21.43' S to "+" south end concrete pipe (P)

30.58' E to North 1/2 Post, Sec. 4, Marion Twp. (Small RR Spike)

S¹/₄

Monroe Township

Section 34

Date Established 9/5/2007

Corner NW

Marker Small RR Spike

43.64' NW to duplex SW/side power pole (new)

46.01' SW to duplex SE/side power pole (new)

40.04' SW to "+" south end RCP

46.73' NW to "+" north end RCP

63.52' SE to duplex SW/side power pole

NW	

Section 34

Date Established 9/5/2007

Corner N¹/₄

Marker Small RR Spike

17.55' NW to 5/8" iron pin 1' north of pavement

16.01' NE to 5/8" iron pin 1' north of pavement

91.80' WSW to duplex N/side power pole

	N ¹ / ₄

Section 34

Date Established 9/5/2007

Corner W¹/₄

Marker Small RR Spike

73.28' NNW to duplex E/side power pole

24.71' ESE to "+" NW corner CB (P)

13.16' WSW to "+" north end concrete headwall (P)

W ¹ / ₄	

Monroe Township

Section 34

Date Established 9/5/2007

Corner SW

Marker Small RR Spike

53.50' NW to "+" SE corner CB (P)

55.37' SE to shiner NW/side buried cable marker

64.92' SE to shiner NW/side power pole

33.22' SSE to duplex N/side power pole

29.74' E to Marion Twp. Corner (Small RR Spike)

SW	

Section 34

Date Established 9/5/2007

Corner S¹/₄

Marker Small RR Spike

16.16' NE to 5/8" iron pin 2' north of pavement

63.75' ESE to shiner N/side power pole

15.52' S to 5/8" iron pin 1' south of pavement

27.58 E to N¹/₄ Post, Sec. 3, Marion Twp. (Small RR Spike)

S ¹ / ₄	

Monroe Township

Section 35

Date Established 9/5/2007

Corner NW

Marker Nail/Shiner

53.79' NW to shiner SE/side telephone pole

44.99' NW to PK north end CMP (P)

75.40' SW to NE corner church foundation

43.55' SE to "+" east end RCP

38.81' SW to duplex SE/side power pole

28.69' SW to "+" center south wall CB

NW	

Section 35

Date Established 9/5/2007

Corner N¼

Marker Small RR Spike

17.57' NE to 5/8" iron pin 1' north of pavement

14.68' SE to 5/8" iron pin (7" deep)

19.39' SW to 5/8" iron pin 5' south of pavement

	N¼

Section 35

Date Established 9/5/2007

Corner W¼

Marker Nail/Shiner

50.82' NW to shiner SE/side power pole

41.79' SW to 5/8" iron pin on west ditch bank

42.97' NNW to duplex 1st GR post (west side)

43.13' NE to mag nail north end plastic tile (P)

40.72' SE to mag nail north end plastic tile (P)

W¼	

Monroe Township

Section 35

Date Established 9/5/2007

Corner SW

Marker RR Spike

44.00' NW to "+" NE wingwall

70.59' NW to shiner SE/side power pole

84.81' ESE to shiner NW/side buried cable marker

60.50' ENE to shiner W/side power pole

39.11' NW to "+" in stub wall

49.46' SW to "+" south end 4-sided box

26.64' E to NW corner , Sec. 2, Marion Twp. (RR Spike)

SW	

Section 35

Date Established 9/5/2007

Corner S¹/₄

Marker RR Spike 1" below surface

15.80' NE to 5/8" iron pin (new) 1' north of pavement

55.15' SE to duplex W/side power pole

40.63' SSE to iron pin on south ditch bank

34.30' E to N¹/₂ Post, Sec. 2, Marion Twp. (RR Spike)

S ¹ / ₄	

Monroe Township

Section 36

Date Established 9/5/2007

Corner NW

Marker Small RR Spike

37.27' NE to "+" SE corner CB (P)

33.22' SE to "+" north end headwall (P)

35.45' SW to "+" north end headwall (P)

41.21' SE to duplex SW/side power pole

NW	

Section 36

Date Established 9/5/2007

Corner N¼

Marker Small RR Spike

20.80' NW to 5/8" iron pin 1' north of pavement

19.78' NE to 5/8" iron pin 1' north of pavement

24.40' S to "+" in face of 4" post (severely leaning)

	N¼

Section 36

Date Established 9/5/2007

Corner NE

Marker Small RR Spike

41.92' NE to PK nail SW/side power pole (new)

55.38' SW to duplex N/side power pole

61.29' NW to "+" north end RCP

47.71' SW to "+" south end RCP

42.64' S to Richfield Twp. Stone (Small RR Spike)

	NE

Monroe Township

Section 36

Date Established 9/5/2007

Corner W¹/₄

Marker Small RR Spike

13.68' NW to 5/8" iron pin 4' west of pavement

29.24' E to duplex N/side power pole

21.18' SW to 5/8" iron pin 4' west of pavement

W ¹ / ₄	

Section 36

Date Established 9/5/2007

Corner E¹/₄

Marker Small RR Spike 1" below surface

38.17' W to duplex N/side 24" tree

23.80' ESE to duplex N/side power pole

87.54' SSE to "+" NW corner CB

90.90' SSW to mag nail in 12" N12 (P)

21.36' S to Richfield Twp. Corner (Small RR Spike)

	E ¹ / ₄

Section 36

Date Established 9/5/2007

Corner SW

Marker Iron Pin 7' South of Pavement

81.00' W to "+" SE bridge abutment

72.17' WNW to "+" NE bridge abutment

26.77' ESE to "+" NW corner CB

80.68' SE to duplex W/side power pole

52.45' SW to duplex SE/side power pole

39.60' E to NW corner, Sec. 1, Marion Twp. (RR Spike)

SW	

Monroe Township

Section 36

Date Established 9/5/2007

Corner S¹/₄

Marker RR Spike 1" below surface


103.18' WNW to duplex S/side telephone pole

96.46' NNE to SW corner concrete foundation

47.46' NE to duplex S/side telephone pole

75.56' ESE to duplex N/side power pole

19.23' E to Marion Twp. Corner (RR Spike)

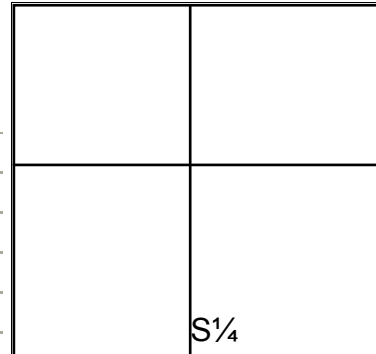

Section 36

Date Established 9/5/2007

Corner SE

Marker Small RR Spike

43.23' WNW to duplex SW/side power pole

56.63' NNE to duplex SE/side power pole

40.22' SE to duplex SW/side power pole

43.53' SE to "+" NW corner CB (P)

42.33' SW to duplex NW/side power pole

31.28' SW to "+" south end concrete pipe (P)

41.05' NW to "+" north end concrete pipe

