

# Bartlow Township

Section 1

Date Established 10/26/2006

Corner NW

Marker Small RR Spike

48.90' WNW to duplex SW/side power pole

38.96' WNW to "+" cut north end 66" CMP

40.04' SE to duplex W/side sign post

38.22' SW to PK south end 66" CMP

10.56' W to SW corner. Sec. 36. Richfield Twp.

48.01' SW to PK nail NE/side power pole

97.75' NNE to SW corner brick veneer house (No field check)

Section 1

Date Established 10/26/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

73.57' WNW to duplex N/side power pole

5.28' W to S<sup>1</sup>/<sub>4</sub> post. Sec. 36. Richfield Twp.

20.86' NW to 5/8" iron pin 6' north of edge of pavement

13.50' SW to 5/8" iron pin 6' south of edge of pavement

Section 1

Date Established 10/26/2006

Corner NE

Marker Small RR Spike

41.73' NW to "+" north end RCP (P)

49.71' NE to duplex SE/side power pole

69.54' SE to duplex SW/side power pole

42.13' SW to south end RCP (P)

NW	

	N <sup>1</sup> / <sub>4</sub>

	NE

# Bartlow Township

Section 1

Date Established 10/26/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker PK Nail - Found iron pin 5.5' west of west edge of pavement

11.90' SW to "+" west end 21" RCP (P)

53.72' NE to duplex NW/side power pole (P)

13.52' NW to "+" south end RCP (P)

34.75' NNW to "+" north end RCP (P)

W <sup>1</sup> / <sub>4</sub>	

Section 1

Date Established 10/26/2006

Corner E<sup>1</sup>/<sub>4</sub>

Marker Iron Pin - Adjusted to 10' off PK's

NOTE: Ties are to iron pin, not stone. Stone is moving to west

36.20' NE to "+" SE corner catch basin top (P)

13.35' SW to PK nail west end 10" CMP (P)

28.53' NW to "+" in witness stone on west ditch bank (P)

	E <sup>1</sup> / <sub>4</sub>

# Bartlow Township

Section 2

Date Established 8/30/2006

Corner NW

Marker RR Spike

68.30' ENE to duplex SW/side cable marker

39.28' SE to duplex north side power pole

40.08' SW to duplex east side brace pole

35.65' NW to 5/8" iron pin 0.5' west of edge of pavement radius

17.16' W to SW corner. Sec. 35. Richfield Twp.

NW	

Section 2

Date Established 5/31/2012

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

27.10' ESE to "+" in SW wingwall

108.46' ENE to "+" in NE wingwall

92.67' NE to "+" in northerly corner of bridge

	N <sup>1</sup> / <sub>4</sub>

Section 2

Date Established 10/26/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

NOTE: Reset iron pin to 10' from PKs. Ties to iron pin. not stone.

5.23' NW to "+" south end concrete headwall

9.70' NW to "+" north end concrete headwall (P)

27.14' ENE to "+" SW corner catch basin (P)

33.85' E to duplex S/side power pole

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 3

Date Established 8/30/2006

Corner NW

Marker Nail & Shiner

68.19' NW to nail/shiner SE/side power pole

47.09' SW to "+" SW corner catch basin (P)

70.54' ENE to shiner west side telephone pole

58.49' SE to duplex north side power pole

58.05' SW to duplex east side power pole

17.72' W to SW corner. Sec. 34. Richfield Twp.

43.51' NW to chiseled "+" SE corner catch basin frame (P)

NW	

Section 3

Date Established 8/30/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike

38.47' NW to duplex west side power pole

35.24' SW to duplex east side power pole

16.61' W to S<sup>1</sup>/<sub>4</sub> Post. Sec. 34. Richfield Twp.

41.10' NE to duplex SE/side power pole

	N <sup>1</sup> / <sub>4</sub>

Section 3

Date Established 10/26/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

Iron Pin is 1' west of west edge of pavement

66.15' NE to nail/shiner SW/side telephone pole

44.36' SE to "+" NW corner catch basin (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 4

Date Established 8/30/2006

Corner NW

Marker RR Spike

59.44' WNW to "+" top edge end concrete bridge rail

40.52' SE to duplex SW/side power pole

19.92' W to SW corner. Sec. 33, Richfield Twp.

41.89' ENE to mag nail north end CMP (P)

69.74' N to duplex south side power pole (NEW)

66.03' SW to duplex west side of east post of church sign

40.64' SE to "+" east end RCP (P)

NW	

Section 4

Date Established 8/30/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike

46.43' SE to duplex north side power pole

17.36' W to S<sup>1</sup>/<sub>4</sub> Post. Sec. 33, Richfield Twp.

9.34' NE to 5/8" iron pin at north edge of pavement

25.12' WNW to 5/8" iron pin at north edge of pavement

	N <sup>1</sup> / <sub>4</sub>

Section 4

Date Established 10/26/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

Iron Pin is 0.5' west of west edge of pavement

22.91' SW to "+" south end 48" RCP (P)

28.21' NW to "+" north end 48" RCP (P)

39.55' ESE to "+" east end 42" RCP (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 4

Date Established 5/4/1982

Corner W<sup>1</sup>/<sub>4</sub> SW


Marker 3/4" Rod

48.67' W to "+" in concrete headwall

18.49' W to PK nail east end 18" CMP (P)

107.18' NNW to duplex E/side telephone pole

27.30' ESE to duplex N/side power pole

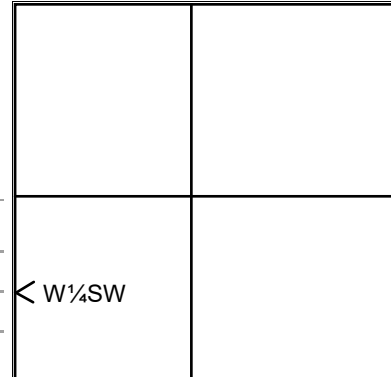

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

# Bartlow Township

Section 5

Date Established 8/30/2006

Corner NW

Marker RR Spike

45.39' SW to duplex west side power pole

55.92' WSW to "+" concrete headwall (P)

65.41' WNW to "+" north end RCP (P)

48.83' NNE to "+" SE corner catch basin (P)

32.63' W to SW corner. Sec. 32. Richfield Twp.

NW	

Section 5

Date Established 8/30/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike

36.51' NNW to "+" on high point of witness stone (P)

47.84' SE to duplex north side power pole

26.53' W to S<sup>1</sup>/<sub>4</sub> Post. Sec. 32. Richfield Twp.

46.90' WNW to PK nail west end buried CMP (P)

29.96' NW to PK nail east end buried CMP (P)

	N <sup>1</sup> / <sub>4</sub>

Section 5

Date Established 10/26/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

64.17' WNW to mag nail west end plastic drive pipe

41.94' SW to "+" west end RCP (P)

40.22' SE to "+" east end RCP (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 6

Date Established 8/30/2006

Corner NW

Marker Small RR Spike

40.18' SE to duplex SW/side power pole

42.35' SW to duplex NW/side power pole

43.22' NW to duplex SW/side power pole

56.63' NE to duplex SE/side power pole

43.51' SE to "+" NW corner catch basin (P)

31.28' SW to "+" south end RCP (P)

41.05' NW to "+" north end RCP (P)

NW	

Section 6

Date Established 8/30/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike

15.65' NE to 5/8" iron pin at north edge of pavement

32.36' W to S<sup>1</sup>/<sub>4</sub> Post. Sec. 31, Richfield Twp.

26.27' NNW to duplex SE/side telephone pole

32.46' S to near face iron anchor post

78.22' WSW to duplex north side power pole

7.51' E to RR Spike (See "E1", Sec. 31, Richfield Twp.)

	N <sup>1</sup> / <sub>4</sub>

Section 6

Date Established 10/26/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike

26.74' NW to "+" in top south end concrete pipe

25.60' E to PK in power pole

59.72' NNW to "+" north end RCP (P)

84.80' N to Iron Pin, E<sup>1</sup>/<sub>4</sub> Sec. 1, Marion Twp.

37.95' N to small RR Spike C/L Road F2

W <sup>1</sup> / <sub>4</sub>	



# Bartlow Township

Section         6        

Date Established     10/26/2006    

Corner   CENTER  


Marker   Iron Pin  

Iron Pin is 10½' north of north edge of pavement

8.37' NNW to "+" west end concrete headwall (P) (Ag. Inlet)

8.80' NNE to "+" east end of concrete headwall (P) (Ag. Inlet)

36.63' S to PK nail south end 12" CMP

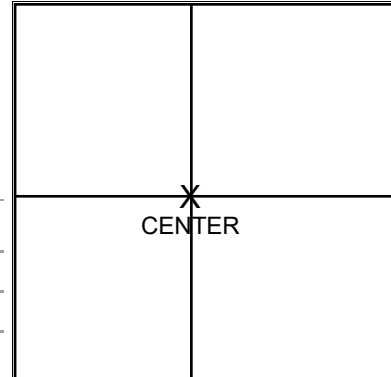

Section         6        

Date Established     10/26/2006    

Corner   W¼ SW  


Marker   RR Spike - 5" Below Surface  

RR Spike is 1' east of west edge of pavement (P)

13.18' SW to "+" top plastic pipe (P)

35.59' SE to duplex SW/side power pole

42.29' ESE to "+" NE corner concrete slab

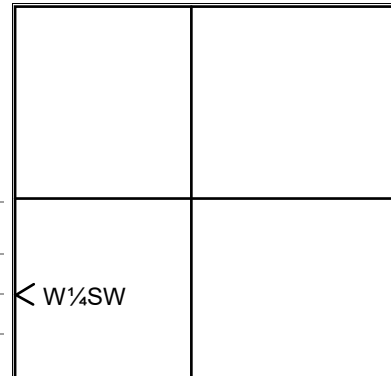

# Bartlow Township

Section 7

Date Established 10/26/2006

Corner NW

Marker RR Spike - 6" below surface at west edge of pavement

61.62' NE to mag nail S/side maple tree

22.67' SW to punched hole on south end of 72" CMP (P)

88.98' NNE to duplex SE/side guard rail post

52.12' SE to PK NW/side power pole (11/7/74 tie) (No field check)

NW	

Section 7

Date Established 10/26/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

24.67' NNE to "+" top center west wall catch basin

19.80' ESE to PK in corrugated plastic pipe (P)

30.18' S to near face steel post

34.34' SW to PK north end 24" CMP (P)

	N <sup>1</sup> / <sub>4</sub>

Section 7

Date Established 10/26/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike

RR Spike - 15" west of west edge of pavement and 6" below surface

131.95' NE to duplex SE/side power pole

96.05' SE to duplex NE/side power pole

17.05' SW to PK nail west end 12" CMP (P)

34.55' NE to "+" west side concrete post

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 8

Date Established 11/3/2006

Corner NW

Marker Small RR Spike

49.70' NE to "+" SE wing of Bridge 6-5.00

41.99' NNW to "+" in SW wingwall of Bridge 6-5.00

61.00' WNW to "+" in NE wingwall of Bridge F-13.00

NW	

Section 8

Date Established 11/3/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

19.44' NW to 5/8" iron pin

22.48' NE to 5/8" iron pin

	N <sup>1</sup> / <sub>4</sub>

Section 8

Date Established 11/3/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

13.04' WSW to mag nail west end 24" CMP (P)

85.13' SSE to duplex W/side power pole

34.48' E to "+" north end concrete headwall (P)

37.60' SE to PK (crushed) south end 12" CMP (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 9

Date Established 11/3/2006

Corner NW

Marker Small RR Spike

23.90' NW to "+" in concrete headwall

44.42' NE to duplex SE/side power pole (New)

29.01' SE to "+" in concrete headwall

20.01' SW to "+" in concrete headwall

NW	

Section 9

Date Established 11/3/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

40.25' NNW to near face well casing

29.61' N to duplex E/side power pole

28.90' SE to "+" in top of large rock (P)

17.36' SW to 5/8" iron pin 3' south of south edge of pavement

	N <sup>1</sup> / <sub>4</sub>

Section 9

Date Established 11/3/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike

82.78' NNE to duplex W/side power pole

25.98' SE to "+" in concrete (P)

29.66' SW to "+" east end 15" concrete pipe (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 10

Date Established 11/3/2006

Corner NW

Marker Nail/Shiner

79.48' NW to "+" 72" RCP (P)

52.05' NE to duplex NW/side power pole

38.48' SE to "+" east end concrete headwall

40.92' SE to nail/shiner NW/side power pole

83.40' W to "+" 72" RCP (P)

NW	

Section 10

Date Established 11/3/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Stone Leaning North

130.75' WNW to duplex S/side power pole (Did not check)

126.64' ENE to duplex S/side power pole (Did not check)

11.25' NW to 5/8" iron pin on ditch bank (Mark to Mark)

11.95' NE to 5/8" iron pin on ditch bank (Mark to Mark)

17.5' N to south edge of pavement

	N <sup>1</sup> / <sub>4</sub>

Section 10

Date Established 11/3/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Nail/Shiner

26.05' WNW to "+" west end 12" concrete pipe (P)

26.78' ENE to "+" east end 12" concrete pipe (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 10

Date Established 5/12/1982

Corner CENTER

Marker Found stone beside wood post

---

---

---


---

---

---

---

---

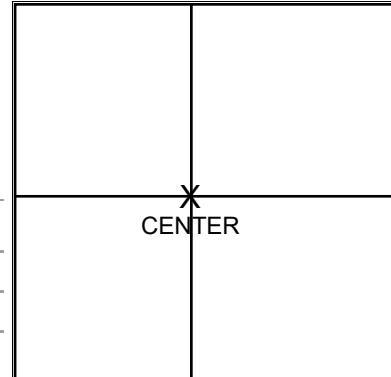

# Bartlow Township

Section 11

Date Established 11/3/2006

Corner NW

Marker Small RR Spike

43.69' NW to duplex SW/side power pole

46.64' NNW to "+" north end 84" CMP (P)

50.24' NE to PK nail NW/side underground cable marker

31.63' ESE to center of bench mark tablet

32.84' SW to "+" south end 84" CMP (P)

NW	

Section 11

Date Established 5/13/1982


Corner OTHER

Marker RR Spike

29.38' NNE to duplex E/side power pole

17.11' S to "+" NE corner concrete box culvert (P)

22.05' SW to "+" NW corner concrete box culvert (P)

 N $\frac{1}{4}$ NWNW	

Section 11


Date Established 5/12/1982

Corner N $\frac{1}{4}$  NW

Marker RR Spike

141.44' WNW to duplex S/side power pole

128.83' ENE to duplex S/side power pole

 N $\frac{1}{4}$ NW	

# Bartlow Township

Section 11

Date Established 11/3/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Iron Pin


31

34.60' N to "+" north end 72" RCP (P)

93.61' ENE to duplex S/side power pole

23.97' S to "+" south end 72" RCP (P)

32.94' WSW to PK west end 24' CMP (P) (No Field Check)

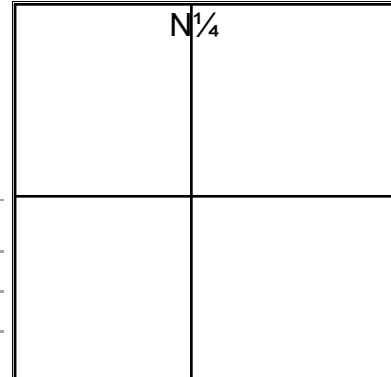

Section 11

Date Established 5/12/1982


Corner W<sup>1</sup>/<sub>4</sub> NW

Marker Iron Pin

30.44' E to duplex SW/side wood anchor post (P)

105.56' SSE to nail/shiner E/side power pole

82.45' WSW to NE corner concrete block building foundation

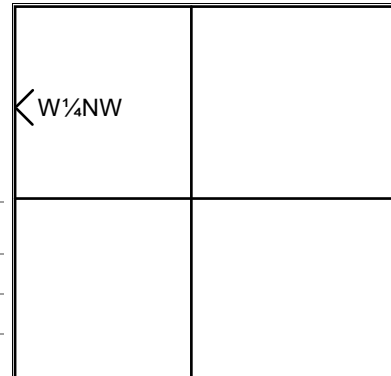

Section 11

Date Established 11/3/2006

Corner W<sup>1</sup>/<sub>4</sub>


Marker Iron Pin - 2' west of west edge of pavement

31.75' NE to iron pin on east edge of pavement

30.49' SE to iron pin on east edge of pavement

66.50' SSW to PK nail west end 12" CMP (P)

33.60' SW to PK nail east end 10" plastic (P)

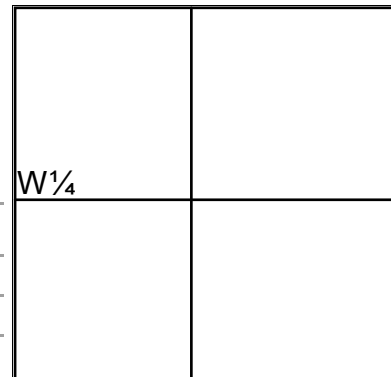



# Bartlow Township

Section 12

Date Established 11/3/2006

Corner NW

Marker Small RR Spike

35.01' NW to "+" north end 48" RCP (P)

54.38' NE to duplex SE/side power pole

59.89' SE to duplex SW/side power pole

34.29' SW to "+" south end 48" RCP (P)

NW	

Section 12

Date Established 11/3/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike

81.45' NE to duplex S/side power pole

23.63' SE to duplex E/side guard rail post

19.24' NNW to "+" top center concrete headwall

20.53' SSW to "+" top center concrete headwall

30.66' SW to duplex W/side guard rail post

22.89' NW to duplex SW/side guard rail post

	N <sup>1</sup> / <sub>4</sub>

Section 12

Date Established 11/3/2006

Corner NE

Marker Small RR Spike

44.85' SW to "+" south end RCP (P)

34.17' NW to PK SE/side power pole

43.60' NW to "+" north end RCP (P)

44.49' NE to "+" east end RCP (P)

33.29' N to NW corner, Sec. 7, Jackson Twp., Wood Co.

	NE

# Bartlow Township

Section 12

Date Established 11/3/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

Found PKs 6' NE & SE

35.44' SSW to "+" west end cast iron pipe

51.89' SSE to "+" NE corner catch basin

W <sup>1</sup> / <sub>4</sub>	

Section 12

Date Established 11/3/2006

Corner E<sup>1</sup>/<sub>4</sub>

Marker RR Spike

53.85' SW to duplex NW/side power pole

29.61' NW to 5/8" iron pin 3' west of west edge of pavement

28.52' SW to 5/8" iron pin 3' west of west edge of pavement

25.34' N to Wood Co. corner

	E <sup>1</sup> / <sub>4</sub>

# Bartlow Township

Section 13

Date Established 11/3/2006

Corner NW

Marker Small RR Spike

- 95.43' WNW to duplex S/side power pole
- 43.73' NE to PK nail SW/side power pole
- 67.54' ESE to duplex SW/side telephone pole
- 32.68' SW to "+" SW corner concrete catch basin (P)

NW	

Section 13

Date Established 5/24/1982

Corner N<sup>1</sup>/<sub>4</sub> NW

Marker RR Spike

- 12.39' NW to 5/8" iron pin at north edge of pavement
- 14.86' NE to 5/8" iron pin at north edge of pavement

N <sup>1</sup> / <sub>4</sub> NW	

Section 13

Date Established 12/8/2009

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

- 30.32' NNE to mag nail north end 48" N12 plastic pipe (P)
- 31.02' SSE to mag nail south end 48" N12 plastic pipe (P)
- 89.75' ESE to PK nail west end 36" CMP (P)

N <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 13

Date Established 11/3/2006

Corner NE

Marker RR Spike

46.21' NNE to duplex NW/side telephone pole

59.37' ENE to duplex SE/side telephone pole

31.55' SE to duplex NE/side telephone pole

52.72' SW to duplex NW/side power pole

34.85' NW to conner wire in concrete monument (P)

17.22' N to RR spike at Wood Co. corner

	NE

Section 13

Date Established 3/18/1982

Corner W<sup>1</sup>/<sub>4</sub> NW

Marker RR Spike

43.71' W to iron pin on west ditch bank

37.85' NNE to duplex SW root 21" maple

72.30' NE to SW corner block porch foundation

24.10' ESE to duplex SW/side power pole

35.54' SE to iron pin (P)

W <sup>1</sup> / <sub>4</sub> NW	

Section 13

Date Established 11/3/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike

27.42' SE to duplex SW/side power pole

27.81' SE to "+" SW corner catch basin (P)

31.73' NW to south end concrete headwall (P)

108.24' NNE to duplex W/side power pole

78.04' W to NE corner house foundation

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 13


Date Established 11/3/2006

Corner E<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

8.43' NW to iron pin in center concrete monument(P)

6.61' SW to iron pin in center concrete monument (P)

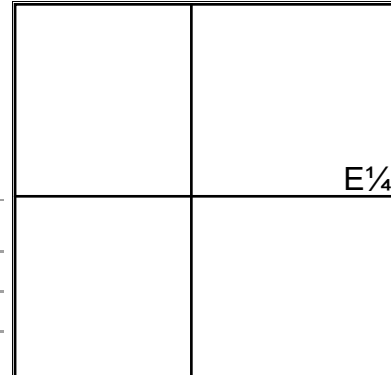

Section 13

Date Established 3/18/1982

Corner W<sup>1</sup>/<sub>4</sub> SW

Marker RR Spike


34.40' W to duplex S/side power pole

17.07' WNW to near face house foundation

32.39' NE to duplex NW/side power pole

71.70' WSW to NE corner porch foundation

86.94' SW to SE corner block house foundation

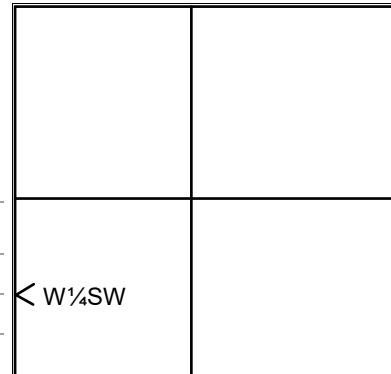

Section 13

Date Established 11/3/2006

Corner OTHER

Marker PK Nail


40.80' WSW to "+" north rim of manhole

56.02' E to SW corner concrete block house foundation

39.94' ESE to duplex SW/side power pole

75.42' SE to duplex W/side brace pole

65.65' SW to duplex E/side light pole

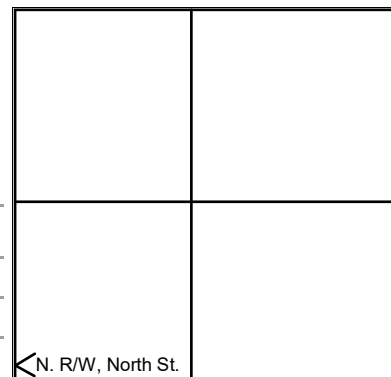

# Bartlow Township

Section 14

Date Established 11/6/2006

Corner NW

Marker Small RR Spike

51.59' ESE to mag nail in corrugated plastic pipe (P)

31.41' SSW to "+" south end concrete headwall (P)

29.29' WSW to "+" at bend in concrete headwall (P)

40.58' NW to chiseled "+" north end 54" RCP

NW	

Section 14

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

26.50' NE to duplex W/side power pole

37.72' NW to duplex SW/side power pole

23.09' SW to "+" corner concrete wingwall

	N <sup>1</sup> / <sub>4</sub>

Section 14

Date Established 11/6/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

52.57' NW to "+" north end RCP (P)

11.56' E to 5/8" iron pin 1' east of edge of pavement

42.21' SE to "+" south end RCP (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 14

Date Established 11/6/2006


Corner CENTER

Marker Small RR Spike

19.83' NW to 5/8" iron pin 2' west of pavement

18.98' SW to 5/8" iron pin 2' west of pavement

43.04' WSW to duplex S/side power pole

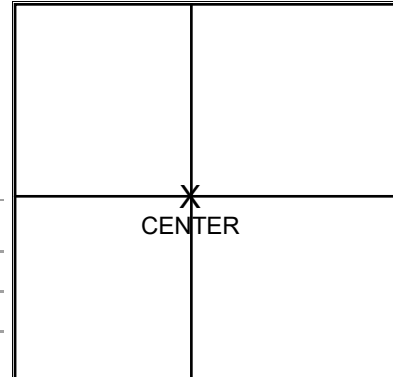

# Bartlow Township

Section 15

Date Established 11/6/2006

Corner NW

Marker Nail/Shiner

58.15' NW to "+" NE corner catch basin (P)

40.48' NE to nail/shiner SW/side power pole

82.88' SE to duplex SW/side telephone pole

58.35' SE to right of way monument

68.98' SE to duplex NE/side power pole

NW	

Section 15

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

18.42' NNW to PK nail E/side power pole

80.08' ESE to duplex NE/side telephone pole

51.03' S to PK nail W/side wood post

73.58' WSW to duplex NW/side telephone pole

	N <sup>1</sup> / <sub>4</sub>

Section 15

Date Established 11/6/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Nail/Shiner

30.93' NE to duplex SW/side underground cable marker (loose)

27.22' SE to "+" in center east wall catch basin (P)

28.53' SW to "+" in center concrete headwall (P)

15.87' NW to "+" in steel guard rail post

W <sup>1</sup> / <sub>4</sub>	



# Bartlow Township

Section 15

Date Established 11/6/2006


Corner CENTER

Marker Iron Pin

24.66' N to "+" S/side metal post

17.61' SE to mag nail east end corrugated plastic pipe (P)

21.77' SW to mag nail east end corrugated plastic pipe (P)

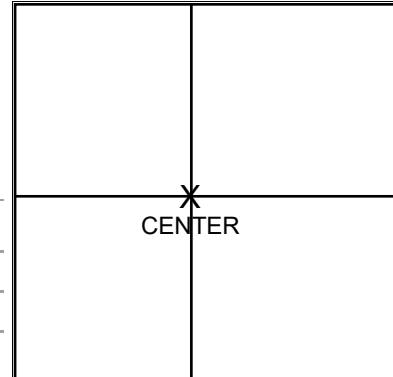

# Bartlow Township

Section 16

Date Established 11/6/2006

Corner NW

Marker Nail/Shiner

49.19' NW to "+" in angle point of concrete headwall (P)

44.64' NE to duplex SE/side power pole

43.82' SW to "+" north corner catch basin (P)

NW	

Section 16

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Nail/Shiner

54.58' NW to duplex SW/side power pole

19.85' N to "+" SW corner catch basin (P)

75.20' NNE to SW corner house foundation

83.50' NE to SE corner porch foundation

34.68' SSW to duplex E/side telephone pole

	N <sup>1</sup> / <sub>4</sub>

Section 16

Date Established 11/6/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

70.05' NE to duplex W/side power pole

15.98' SSW to 5/8" iron pin 2' west of edge of pavement

22.44' SE to 5/8" iron pin 2' east of edge of pavement

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 17

Date Established 11/6/2006

Corner NW

Marker PK Nail

47.60' NW to "+" in center of concrete headwall

99.89' NE to SW corner house foundation

52.08' SW to "+" east end concrete headwall

NW	

Section 17

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker PK Nail

96.36' WNW to duplex NE/side power pole

19.34' N to "+" west end 8" CIP (P)

29.80' NE to "+" east end 8" CIP (P)

	N <sup>1</sup> / <sub>4</sub>

Section 17

Date Established 11/6/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

17.37' W to "+" north end concrete headwall (P)

21.67' E to duplex N/side wood post

23.63' ESE to "+" SW corner catch basin (P)

18.11' WSW to "+" south end concrete headwall (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 18

Date Established 11/6/2006

Corner NW

Marker Small RR Spike

41.11' NW to nail/shiner NE/side 18" maple

58.56' NE to "+" in NW cap bolt fire hydrant

29.72' SE to nail/shiner NW/side power pole

84.05' N to NE corner Sec. 13. Marion Twp.

NW	

Section 18

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker PK Nail

28.91' N to duplex W/side power pole

20.38' N to PK nail west end 8" CMP (P)

39.77' NE to PK nail east end 8" CMP (P)

72.00' ESE to duplex NE/side telephone pole

36.37' S to duplex W/side power pole

	N <sup>1</sup> / <sub>4</sub>

# Bartlow Township

Section 19

Date Established 11/6/2006

Corner NW

Marker Iron Pin - 1' west of edge of pavement

28.92' NW to "+" south end 96" CMP arch (P)

8.29' NW to duplex NE/side power pole

79.55' N to NE corner Sec. 24, Marion Twp.

63.32' SE to duplex SW/side power pole

75.88' NNW to duplex S/side wood guard rail post

NW	

Section 19

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

96.13' ENE to duplex S/side power pole

11.30' S to "+" in concrete headwall (P) (Not at end)

92.49' WSW to duplex NW/side power pole

33.00' SW to "+" south end concrete headwall (P)

	N <sup>1</sup> / <sub>4</sub>

Section 19

Date Established 11/6/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

52.20' SE to NW corner concrete block catch basin

45.50' SW to PK nail in corrugated plastic pipe

55.54' NNW to duplex E/side power pole

68.52' N to E<sup>1</sup>/<sub>4</sub> Post, Sec. 24, Marion Twp. (No Field Check)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 19

Date Established 11/6/2006

Corner CENTER


Marker Iron Pin

22.04' NW to 5/8" iron pin

24.30' NE to 5/8" iron pin (bent)

25.24' SW to "+" north face RR iron post

29.00' W to PK nail north end 12" CMP (P)

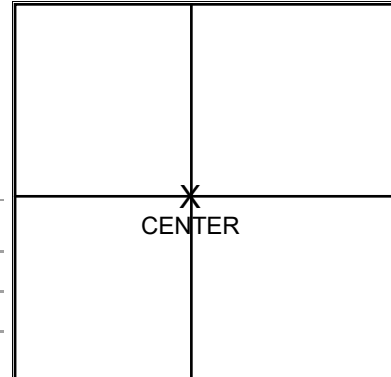

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

# Bartlow Township

Section 20

Date Established 11/6/2006

Corner NW

Marker Small RR Spike

38.88' SE to "+" east end RCP

40.11' SE to duplex E/side telephone pole

45.07' SW to PK nail NW/side power pole

31.34' SW to "+" west end RCP (P)

NW	

Section 20

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

34.09' NW to duplex SW/side power pole

79.35' ENE to duplex NW/side underground cable marker

	N <sup>1</sup> / <sub>4</sub>

Section 20

Date Established 11/6/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

Stone is 7.5' west of east edge 12' pavement

28.39' W to "+" west end RCP (P)

28.60' E to "+" east end RCP (P)

62.49' SE to duplex W/side telephone pole

34.49' NW to duplex NE/side power pole

42.54' SW to "+" south end RCP (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 21

Date Established 11/6/2006

Corner NW

Marker RR Spike

36.74' NE to duplex SE/side power pole

32.00' ESE to hole punched in east end 60" CSP (P)

38.17' SE to duplex E/side power pole

27.13' SW to hole punched in west end 60" CSP (P)

NW	

Section 21

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

30.95' NW to duplex E/side power pole

71.34' NE to duplex NW/side 24" pine

42.40' SW to PK nail west end 21" CMP

	N <sup>1</sup> / <sub>4</sub>

Section 21

Date Established 11/6/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike

38.47' ENE to "+" north end concrete headwall (P)

37.42' E to "+" south end concrete headwall (P)

45.45' SW to mag nail SE/side maple

17.93' NW to mag nail west end CMP (P)

W <sup>1</sup> / <sub>4</sub>	



# Bartlow Township

Section 22

Date Established 11/6/2006

Corner NW

Marker Nail/Shiner

68.37' WSW to mag nail west end corrugated plastic pipe (P)

48.08' SW to "+" south end RCP (P)

50.80' NW to "+" north end RCP (P)

79.71' NNW to duplex W/side power pole

NW	

Section 22

Date Established 11/6/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Nail/Shiner

101.98' N to SW corner block house foundation

128.95' NE to SE corner block foundation

	N <sup>1</sup> / <sub>4</sub>

Section 22

Date Established 11/6/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Nail/Shiner

28.18' ENE to "+" north end concrete headwall (P)

25.95' E to "+" south end concrete headwall (P)

9.00' SW to 5/8" iron pin 2' west of pavement

24.73' NW to mag nail in corrugated plastic pipe

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 23

Date Established 11/8/2006

Corner NW

Marker Nail/Shiner

42.72' NW to nail/shiner SE/side power pole

34.03' NW to "+" north end 60" RCP (P)

44.81' NE to nail/shiner SW/side power pole

26.37' SW to "+" south end 60" RCP (P)

42.11' SW to nail/shiner NE/side power pole

37.10' SE to nail/shiner SE/side power pole

NW	

Section 23

Date Established 11/8/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike

60.75' NNW to "+" south end concrete headwall (P)

61.23' NNE to "+" SW corner catch basin

57.92' NNE to duplex W/side power pole

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 24

Date Established 11/8/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

55.40' ESE to small PK nail NW/side power pole

63.75' WSW to duplex N/side power pole

87.60' NNW to SW corner brick house

20.37' ESE to "+" S/side manhole rim

	N <sup>1</sup> / <sub>4</sub>

Section 24

Date Established 11/8/2006

Corner NE

Marker Small RR Spike

32.00' NW to "+" north end CMP arch (P)

28.55' SW to "+" south end CMP arch (P)

36.18' SW to duplex NW/side power pole

74.70' WSW to duplex NW/side power pole

	NE

Section 24

Date Established 8/31/2006

Corner E<sup>1</sup>/<sub>4</sub> NE

Marker Small RR Spike

6.22' NW to iron pin on west ditch bank (New)

5.18' SW to iron pin on west ditch bank (New)

27.82' NE to iron pin 2' east of edge of pavement

26.30' SE to iron pin 2' east of edge of pavement

	E <sup>1</sup> / <sub>4</sub> NE >

# Bartlow Township


Section 24

Date Established 11/8/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike

- 74.85' NE to SW corner house foundation
- 25.45' NE to "+" east rim of manhole
- 24.82' SW to "+" south rim of manhole
- 87.25' SW to NE corner brick house foundation (No Field Check)
- 34.94' SE to duplex SW/side power pole
- 29.95' SW to duplex NW/side power pole

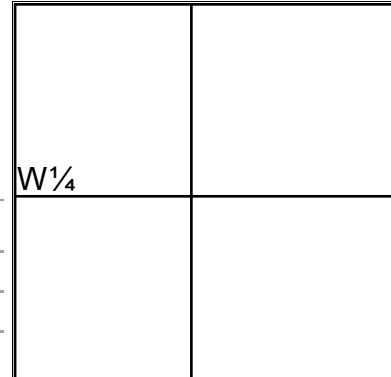


Section 24

Date Established 11/8/2006

Corner CENTER

Marker RR Spike

- 43.49' NW to duplex S/side wood gate post
- 32.37' SE to duplex NE/side power pole
- 32.32' SW to duplex NW/side power pole
- 57.57' SSW to duplex NW/side power pole
- 27.19' NE to duplex SE/side power pole

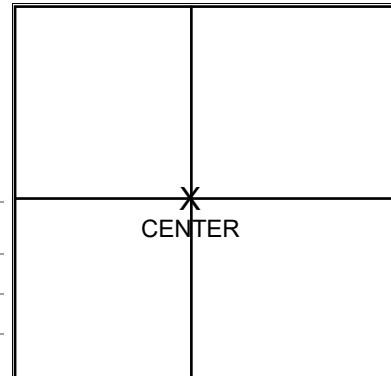


Section 24

Date Established 8/31/2006

Corner E<sup>1</sup>/<sub>4</sub>

Marker Iron Pin - 8" below edge of berm

- 49.53' NNW to "+" north end RCP (P)
- 60.78' NE to nail/shiner SW/side power pole
- 35.82' E to duplex N/side telephone pole
- 7.01' SW to "+" south end RCP (P)
- 17.68' W to nail/shiner E/side telephone pole
- 34.31' E to nail/shiner NW/side power pole

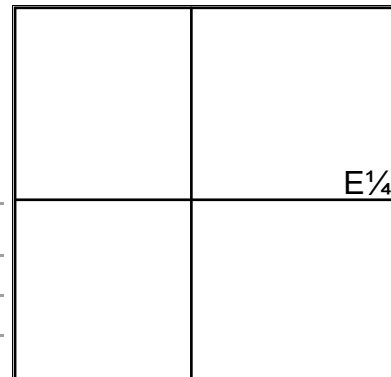

# Bartlow Township

Section 25

Date Established 8/31/2006

Corner NW

Marker RR Spike

60.00' WNW to duplex S/side telephone pole (No Field Check)

51.29' SW to duplex NW/side power pole

19.67' SW to "+" corner headwall

107.03' WNW to duplex N/side cable marker

69.54' NW to "+" north end RCP

NW	

Section 25

Date Established 11/8/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike

31.46' SW to "+" south end RCP (P)

37.52' SW to small PK nail NE/side power pole

43.74' NW to "+" north end RCP (P)

42.56' SE to mag nail east end corrugated plastic pipe (P)

	N <sup>1</sup> / <sub>4</sub>

Section 25

Date Established 8/30/2006

Corner NE

Marker RR Spike

42.38' SW to "+" south end RCP (P)

50.32' NW to "+" north end RCP (P)

46.39' NW to GPS Monument (P)

26.42' NE to duplex NW/side power pole

32.52' SE to duplex W/side power pole

37.87' SW to duplex N/side power pole

33.50' N to SW corner, Sec. 30, Jackson Twp., Wood County

	NE

# Bartlow Township

Section 25

Date Established 8/30/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike


33.42' NE to duplex SE/side power pole

47.42' SE to mag nail east end 24" CMP (P)

26.32' SW to "+" south end RCP (P)

33.95' NW to "+" north end RCP (P)

35.85' NW to duplex SW/side (P)

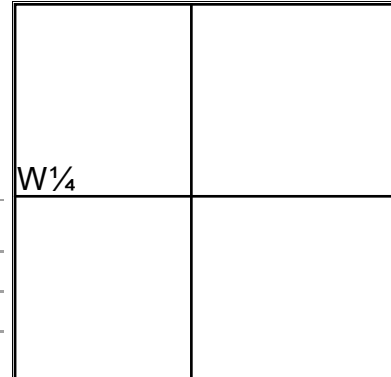

Section 25

Date Established 11/8/2006

Corner CENTER

Marker Small RR Spike

Set concrete nails 6' north and east


29.52' NW to duplex E/side power pole

26.29' NW to "+" north end RCP (P)

41.16' SE to "+" SE corner catch basin (P)

25.80' SW to "+" south end RCP (P)

32.64' SW to "+" east end RCP (P)

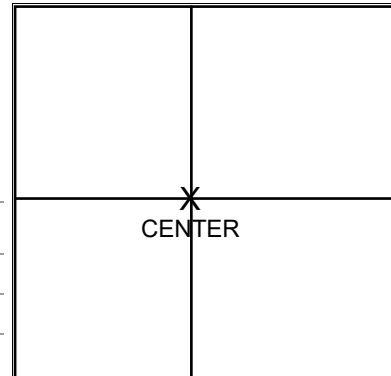

Section 25

Date Established 8/30/2006

Corner E<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

41.02' NW to "+" north end RCP (P)


53.20' NE to PK nail SW/side telephone pole

31.37' SE to duplex NE/side power pole

56.91' NE to "+" NE corner catch basin (P)

35.44' SW to "+" south end RCP (P)

26.77' N to Wood Co. corner

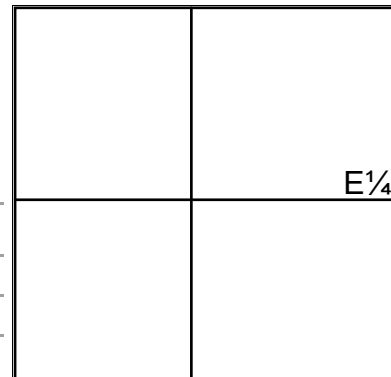

# Bartlow Township

Section 26

Date Established 11/8/2006

Corner NW

Marker Small RR Spike

72.60' WNW to duplex SW/side power pole

32.15' SE to duplex SW/side power pole

37.01' SW to duplex NW/side power pole

56.22' WSW to "+" west end concrete pipe (P)

NW	

Section 26

Date Established 11/8/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

17.30' NE to 5/8" iron pin at east edge of pavement

20.01' NW to 5/8" iron pin at west edge of pavement

57.48' SE to duplex W/side power pole

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 27

Date Established 11/8/2006

Corner NW

Marker Nail/Shiner

36.85' NE to nail/shiner SW/side power pole

47.47' SE to nail/shiner W/side telephone pole

39.89' SW "+" south end CMP (P) (12" from end)

34.63' NW to "+" north end CMP (P)

NW	

Section 27

Date Established 11/8/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Capped Iron Pin

82.15' WNW to duplex S/side power pole

131.95' ENE to duplex S/side power pole

90.18' ESE to duplex SW/side power pole (7/14/82)

24.20' N to duplex W/side wood post

	N <sup>1</sup> / <sub>4</sub>

Section 27

Date Established 11/8/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Nail/Shiner

92.93' NE to NW corner block house foundation

74.23' NE to SW corner block house foundation

27.06' SW to mag nail south end corrugated plastic pipe (P) (1' from en

27.82' NW to mag nail south end corrugated plastic pipe (P) (1' from en

W <sup>1</sup> / <sub>4</sub>	



# Bartlow Township

Section 28

Date Established 11/8/2006

Corner NW

Marker RR Spike

33.61' NE to PK nail NW/side power pole

51.89' SSE to PK nail W/side telephone pole

23.92' SW to hole punched in south end 60" CMP (P)

31.90' NW to hole punched in north end 60" CMP (P)

23.14' NNW to PK nail E/side brace pole

NW	

Section 28

Date Established 11/8/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike - 4" below edge of pavement

25.19' NW to 5/8" iron pin on north edge of pavement

28.05' NE to duplex W/side power pole

	N <sup>1</sup> / <sub>4</sub>

Section 28

Date Established 11/8/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Removed loose RR Spike

Set 5/8" Iron Pin from PK's 6' NW and SW. Iron Pin is 1.5' west of pave

146.44' NNE to duplex W/side power pole

22.70' E to duplex W/side wood post

132.48' SSE to duplex W/side power pole

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 29

Date Established 11/8/2006

Corner NW

Marker RR Spike

29.31' ESE to "+" NE bridge wing (P)

27.90' SE to "+" face of east bridge rail

33.23' SSW to "+" in SW bridge wing (P)

22.01' WSW to "+" NW bridge wing (P)

16.53' SW to USGS benchmark tablet

36.92' NW to duplex SW/side power pole

NW	

Section 29

Date Established 11/8/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

28.29' NW to "+" in west end of concrete headwall (P)

23.73' NNE to "+" in east end of concrete headwall (P)

16.40' SSE to "+" in east end of concrete headwall (P)

22.54' SW to "+" in west end of concrete headwall (P)

	N <sup>1</sup> / <sub>4</sub>

Section 29

Date Established 11/8/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

Surveyor's Note: I.P. is moving with ditch bank to west.

Check north-south alignment

43.15' SE to duplex NE/side power pole

16.18' SW to PK nail west end 12" CMP (P)

28.93' NW to 5/8" iron pin 4' east of pavement

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 30

Date Established 11/9/2006

Corner NW

Marker Small RR Spike

58.23' N to NE corner, Sec. 25, Marion Twp. (8/21/82)

66.44' NW to "+" chiseled in south end of CMP arch (P)

124.26' N to duplex E/side power pole

58.13' SE to mag nail east end corrugated plastic pipe (P)

41.25' SSW to duplex E/side power pole

8.03' NW to duplex E/side guard rail post (Loose)

NW	

Section 30

Date Established 10/1/2014

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike

33.86' N to "+" in 2" steel post (leaning)

17.74' S to "+" in west end 48" RCP

81.36' ESE to "+" 2' west of east end 48" RCP

	N <sup>1</sup> / <sub>4</sub>

Section 30

Date Established 11/9/2006

Corner W<sup>1</sup>/<sub>4</sub> NW

Marker RR Spike

61.27' NNW to "+" SW bridge wing (P)

55.51' NNW to "+" SE bridge wing (P)

82.51' NNW to duplex E/side power pole

73.05' SSE to "+" NW corner concrete block catch basin (P)

64.72' SSW to mag nail west end corrugated plastic pipe (P)

W <sup>1</sup> / <sub>4</sub> NW	

# Bartlow Township

Section 30

Date Established 11/8/2006

Corner W<sup>1</sup>/<sub>4</sub>


Marker Small RR Spike

68.63' N to E<sup>1</sup>/<sub>4</sub> post. Sec. 25. Marion Twp.

52.87' SSE to "+" NW corner catch basin (P)

19.58' SSW to duplex NW/side power pole

46.47' SSW to mag nail in corrugated plastic pipe (P)

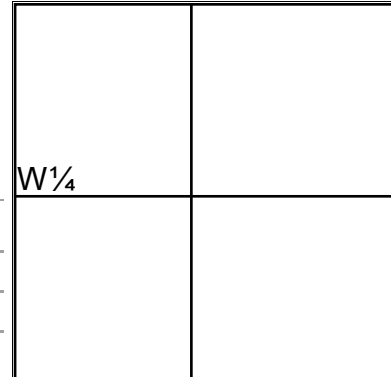

Section 30


Date Established 12/4/2006

Corner OTHER

Marker RR Spike - 2" Below Surface

46.93' SSE to "+" NW corner concrete slope riser on catch basin (P)

21.75' SSW to duplex E/side power pole

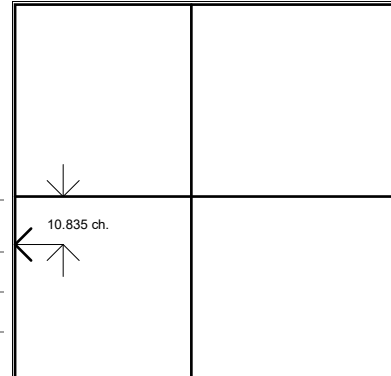

# Bartlow Township

Section 31

Date Established 11/9/2006

Corner NW

Marker Iron Pin - 4' west of pavement

23.33' NNW to PK - S/side power pole

80.86' N to center of cornerstone NE corner, Sec. 36, Marion Twp. (7/8/

17.03' W to "+" in south end CMP (P)

88.35' NW to mag nail SE/side power pole

NW	

Section 31

Date Established 11/9/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

29.23' SSE to duplex E/side power pole

22.23' S to PK nail north end 15" CSP (P)

18.50' S to mag nail west end corrugated plastic pipe (P)

69.45' ESE to mag nail east end corrugated plastic pipe (P)

	N <sup>1</sup> / <sub>4</sub>

Section 31

Date Established 11/9/2006

Corner N<sup>1</sup>/<sub>4</sub> NE

Marker Small RR Spike

39.16' SE to 5/8" iron pin on south ditch bank

28.16' S to 5/8" iron pin on south ditch bank

67.47' WSW to duplex SE/side power pole

	N <sup>1</sup> / <sub>4</sub> NE

# Bartlow Township

Section 31

Date Established 11/9/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

72.69' NNW to duplex E/side power pole

133.98' SSW to duplex E/side power pole

40.70' N to E<sup>1</sup>/<sub>4</sub> post. Sec. 36, Marion Twp.

11.00' SW to 5/8" iron pin 2' west of pavement

23.15' SE to 5/8" iron pin 2' west of pavement

W <sup>1</sup> / <sub>4</sub>	

Section 31

Date Established 11/9/2006

Corner SW

Marker RR Spike at east edge of pavement

Set new PK's 6' SW and NW

55.72' NNW to shiner SE/side power pole

77.23' WNW to SE corner house foundation

76.48' SSE to "+" in bridge wing

16.60' E to center of GIS monument (P)

SW	

Section 31

Date Established 11/9/2006

Corner S<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

Iron Pin is 3' north of the south edge of stone road

32.53' ENE to "+" in NW bridge wing (P)

55.86' ESE to "+" in SW bridge wing (P)

13.68' SSW to "+" NE corner catch basin (P)

	S <sup>1</sup> / <sub>4</sub>

# Bartlow Township

Section 32

Date Established 11/9/2006

Corner NW

Marker Small RR Spike

47.74' NW to "+" north end RCP (P)

42.83' NE to duplex SE/side buried cable marker

44.84' SE to duplex NE/side power pole

49.30' SW to "+" south end RCP (P)

NW	

Section 32

Date Established 11/9/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

14.00' NW to 5/8" iron pin 2' north of pavement

16.94' SW to 5/8" iron pin 2' south of pavement

32.49' SSE to mag nail south end CSP (P)

33.82' NNE to mag nail north end CSP (P)

	N <sup>1</sup> / <sub>4</sub>

Section 32

Date Established 11/9/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

45.26' NE to duplex S/side power pole

63.58' SE to duplex SW/side 12" tree

28.16' SE to "+" W/side metal mailbox post

44.98' NW to "+" west end metal pipe (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 32

Date Established 11/9/2006

Corner SW

Marker RR Spike

33.70' NW to "+" north end RCP (P)


77.84' ENE to duplex S/side telephone pole

107.85' ESE to duplex SW/side telephone pole

83.50' SSE to duplex NE/side brace poel

23.14' SW to "+" south end RCP (P)

36.01' NW to duplex S/side power pole

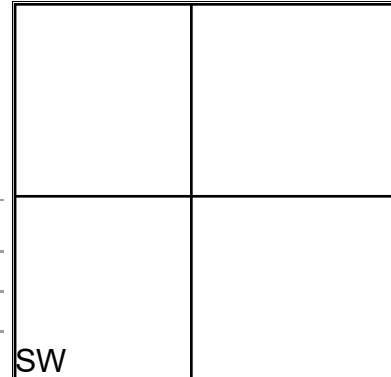

Section 32

Date Established 11/9/2006

Corner S<sup>1</sup>/<sub>4</sub>

Marker RR Spike


83.92' WNW to duplex S/side power pole

14.19' NW to "+" west end concrete headwall (P)

11.35' NNW to "+" east end concrete headwall (P)

21.23' SSW to "+" east end concrete headwall (P)

22.87' SW to "+" west end concrete headwall (P)

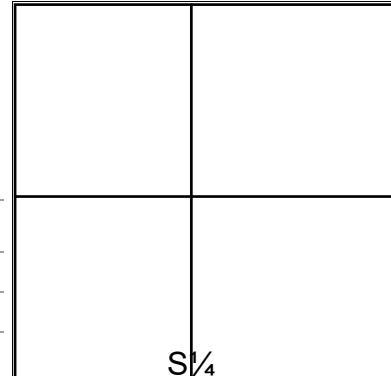



# Bartlow Township

Section 33

Date Established 11/9/2006

Corner NW

Marker Small RR Spike

55.65' SE to mag nail east end corrugated plastic pipe (P)

49.04' SW to mag nail west end corrugated plastic pipe (P)

32.97' NW to 5/8" iron pin 2' north of pavement

36.99' NE to 5/8" iron pin 2' north of pavement

NW	

Section 33

Date Established 11/9/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Iron Pin

28.72' N to duplex W/side wood post

7.60' S to "+" south end 12" CIP (P)

19.83' S to PK nail north end 18" CMP (P)

69.45' W to mag nail south end corrugated plastic pipe (P)

	N <sup>1</sup> / <sub>4</sub>

Section 33

Date Established 11/9/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker RR Spike

55.16' SE to mag nail east end aluminum pipe (P)

58.60' SW to "+" in top ag. inlet (P)

20.45' W to mag nail west end CMP (P)

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 33

Date Established 11/9/2006

Corner SW

Marker RR Spike

64.77' WSW to "+" east end concrete headwall (P)

65.38' WNW to "+" east end concrete headwall (P)

70.10' ESE to "+" west end concrete headwall (P)

88.95' ENE to duplex S/side power pole


SW

Section 33

Date Established 11/13/2006

Corner S $\frac{1}{4}$

Marker Drove 5/8" Iron Pin - Set concrete nails 6' N and W

Found small PK on surface. No RR Spike found. Removed PK nail.

66.44' WNW to duplex NE/side power pole

29.91' NE to "+" west end concrete headwall (P)

46.43' SE to "+" west end concrete headwall (P)

38.95' ENE to "+" north end RCP (P)


S $\frac{1}{4}$

# Bartlow Township

Section 34

Date Established 10/16/2015

Corner NW

Marker RR Spike

39.18' NE to duplex on NW side of power pole

52.61' NW to "+" in RCP (P)

47.31' SW to "+" in RCP (P)

NW	

Section 34

Date Established 11/13/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike

20.27' N to PK nail W/side power pole

21.36' N to duplex E/side wood post

34.26' SW to "+" SE bridge wing

18.72' SW to "+" NE bridge wing

40.70' SW to "+" NW bridge wing

57.96' SW to duplex NW/side power pole

	N <sup>1</sup> / <sub>4</sub>

Section 34

Date Established 9/28/2017

Corner W<sup>1</sup>/<sub>4</sub>

Marker Mag Nail over RR Spike (\* = ties to wrong point)

30.42' SE to "x" in NE corner catch basin

28.11' SE to Mag Nail in south end corr. plastic pipe

31.00' E to H. Behrman property pin

35.64' NE to Mag Nail in north end corr. plastic pipe

31.69' SE to + NE cor. CB:35.85' NE mag nail corr. pl. 2' from N/end \*

28.04' SW to mag nail west end corrugated plastic pipe at ground line\*

29.25' SE to mag nail in corrugated plastic pipe 2' from south end (P)\*

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 34

Date Established 11/13/2006

Corner SW

Marker Nail/Shiner

25.16' NW to "+" east end banister

97.10' WNW to nail/shiner SE/side power pole

61.40' NW to nail/shiner SE/side power pole

73.80' ENE to "+" SE corner catch basin (P)

40.55' SE to "+" NE corner catch basin (P)

22.80' SW to "+" north face concrete banister

29.41' SW to "+" west end RCP (P)

Section 34

Date Established 11/13/2006

Corner S $\frac{1}{4}$



Marker Iron Pin and PK's 6' NE & NW

24.53' NW to 5/8" iron pin on north edge of pavement

26.60' NE to 5/8" iron pin on north edge of pavement

82.84' E to iron pin at N $\frac{1}{4}$  post. Sec. 3. Van Buren Twp., Putnam Co. (8

53.27' ESE to "+" west end RCP (P)

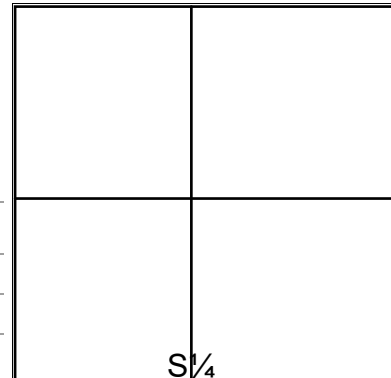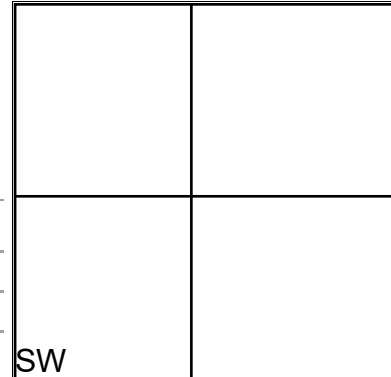

# Bartlow Township

Section 35

Date Established 11/13/2006

Corner NW

Marker RR Spike

27.26' NE to duplex SW/side power pole

60.31' ESE to duplex SW/side power pole

17.98' SE to "+" east end concrete headwall

76.93' SSE to duplex W/side power pole

34.25' SW to "+" south end concrete headwall

NW	

Section 35

Date Established 5/17/2013

Corner N<sup>1</sup>/<sub>4</sub>

Marker RR Spike set - no stone found

28.00' SE to mag nail north side of power pole

16.45' SSW to chiseled "x" south end RCP

29.48' NNW to chiseled "x" north end RCP

19.97' NE to iron pin along road

	N <sup>1</sup> / <sub>4</sub>

Section 35

Date Established 11/13/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

46.13' NE to mag nail NW/side 18" maple

77.20' NE to SW corner block house foundation

53.00' SSE to duplex W/side power pole

31.54' W to mag nail S/side 12" hickory

W <sup>1</sup> / <sub>4</sub>	

# Bartlow Township

Section 35

Date Established 11/13/2006

Corner SW

Marker RR Spike


53.72' NW to "+" in north end RCP (P)

79.61' ENE to duplex S/side telephone pole

34.16' SE to "+" in concrete headwall (P)

43.80' SE to duplex W/side power pole (P)

22.15' SW to "+" in concrete headwall (P)

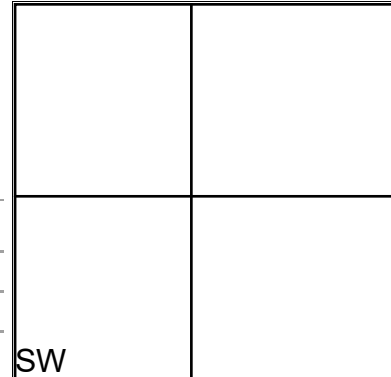

Section 35

Date Established 11/13/2006


Corner S<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

22.69' NW to 5/8" iron pin at north edge of pavement

54.20' NE to 5/8" iron pin at north edge of pavement

15.29' SW to 5/8" iron pin 2' south of pavement

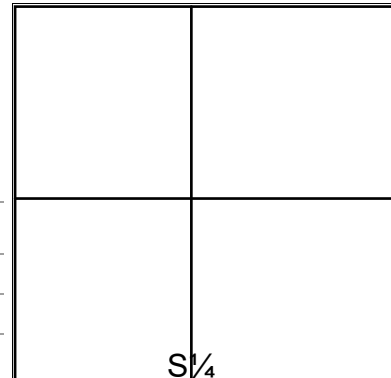

# Bartlow Township

Section 36

Date Established 8/31/2006

Corner NW

Marker Small RR Spike

38.06' NW to PK nail north end CMP (P)

37.69' SE to duplex NE/side underground cable post

38.77' SW to PK nail south end CMP (P)

48.20' SW to duplex NW/side power pole

46.48' SE to "+" south corner catch basin (P)

NW	

Section 36

Date Established 8/31/2006

Corner N<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

22.74' S to "+" south end RCP (P)

33.67' N to "+" north end RCP (P)

11.93' S to duplex W/side mail box post

44.06' ESE to mag nail east end plastic pipe (P)

35.37' ENE to duplex NW/side buried cable marker (No Field Check)

28.90' SE to duplex SW/side buried cable marker (No Field Check)

	N <sup>1</sup> / <sub>4</sub>

Section 36

Date Established 8/31/2006

Corner NE

Marker Small RR Spike

39.49' E to "+" W/side round catch basin (P)

39.07' SW to duplex NW/side power pole

39.12' NW to "+" north end concrete pipe

31.38' SW to "+" south end CMP (P)

44.99' NW to duplex SW/side brace pole

	NE

# Bartlow Township

Section 36

Date Established 8/31/2006

Corner W<sup>1</sup>/<sub>4</sub>

Marker Small RR Spike

- 31.15' W to duplex N/side power pole
- 14.95' W to PK nail west end 8" CMP (P)
- 24.27' ESE to "+" SE corner catch basin (P)
- 23.18' NE to iron pin 3' east of edge of pavement

W <sup>1</sup> / <sub>4</sub>	

Section 36

Date Established 8/31/2006

Corner E<sup>1</sup>/<sub>4</sub>

Marker RR Spike

- 26.04' W to PK nail east end 8" CMP (P)
- 9.88' NW to iron pin 0.5' west of edge of pavement
- 25.85' NE to "+" SE corner catch basin (P)
- 19.24' SW to "+" west end RCP (P)
- 4.96' N to Wood Co. corner

	E <sup>1</sup> / <sub>4</sub>

Section 36

Date Established 8/31/2006

Corner SW

Marker Small RR Spike

- 44.46' NW to duplex NE/side power pole
- 38.93' NW to "+" north end concrete pipe
- 16.88' SSW to "+" east end concrete headwall
- 34.62' SW to "+" west end concrete headwall

SW	



# Bartlow Township

Section 36

Date Established 8/31/2006

Corner S<sup>1</sup>/<sub>4</sub>


Marker RR Spike

43.02' NE to duplex NW/side power pole

73.34' SE to duplex SW/side power pole

21.50' NW to iron pin at north edge of pavement

2645.27' E to SE corner Sec. 36, Bartlow Twp. (8/18/82)

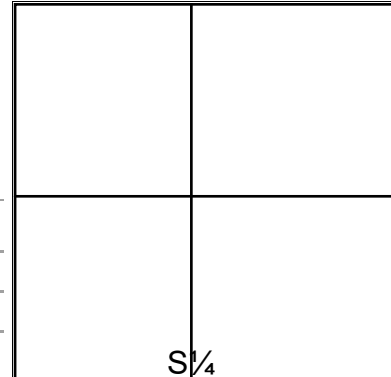

Section 36

Date Established 8/31/2006

Corner SE

Marker RR Spike

39.69' NE to duplex NW/side power pole

39.31' SW to "+" west end RCP (P)

32.03' SE to "+" east end RCP (P)

36.75' SSE to Hancock Co. Monument (P)

